



# LIVING ROOM - Side A

K 32" → - BRICK TO BRICK


↑  
70"  
BRICK  
TO  
BRICK  
↓

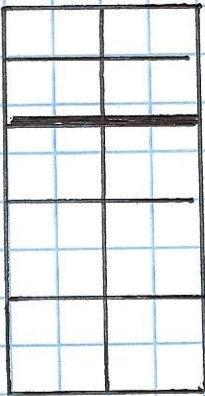

1/3 - 2/3  
DOUBLE  
HUNG

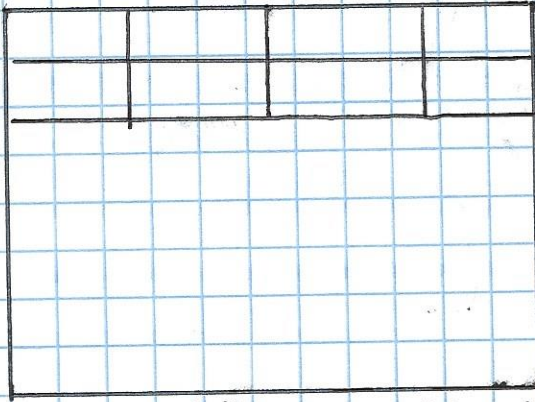

← 56" BRICK TO BRICK →  
FIXED UNIT

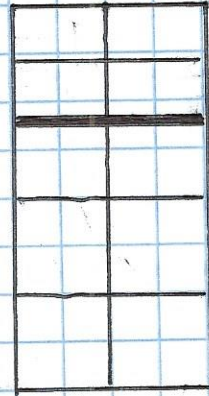


1/3 - 2/3  
DOUBLE  
HUNG  
40/60

• COLONIAL  
MOUNTAIN  
BARS

- Brickmole VARIES IN SIZE FROM 1 1/4" - 1 1/2" - 1 3/4" - 2" NOT UNIFORM
- THESE ARE IN A BRICK OPENING, JUST ALL PAINTED TRIM
- FIXED STORM WINDOW IN POOR NON-WORKING CONDITION


DRAWING OF  
SIDE  
DOUBLE HUNG  
ON FRONT  
WINDOWS

- New W/IZs  
will be  
within 3/8"  
on all edges  
& frame

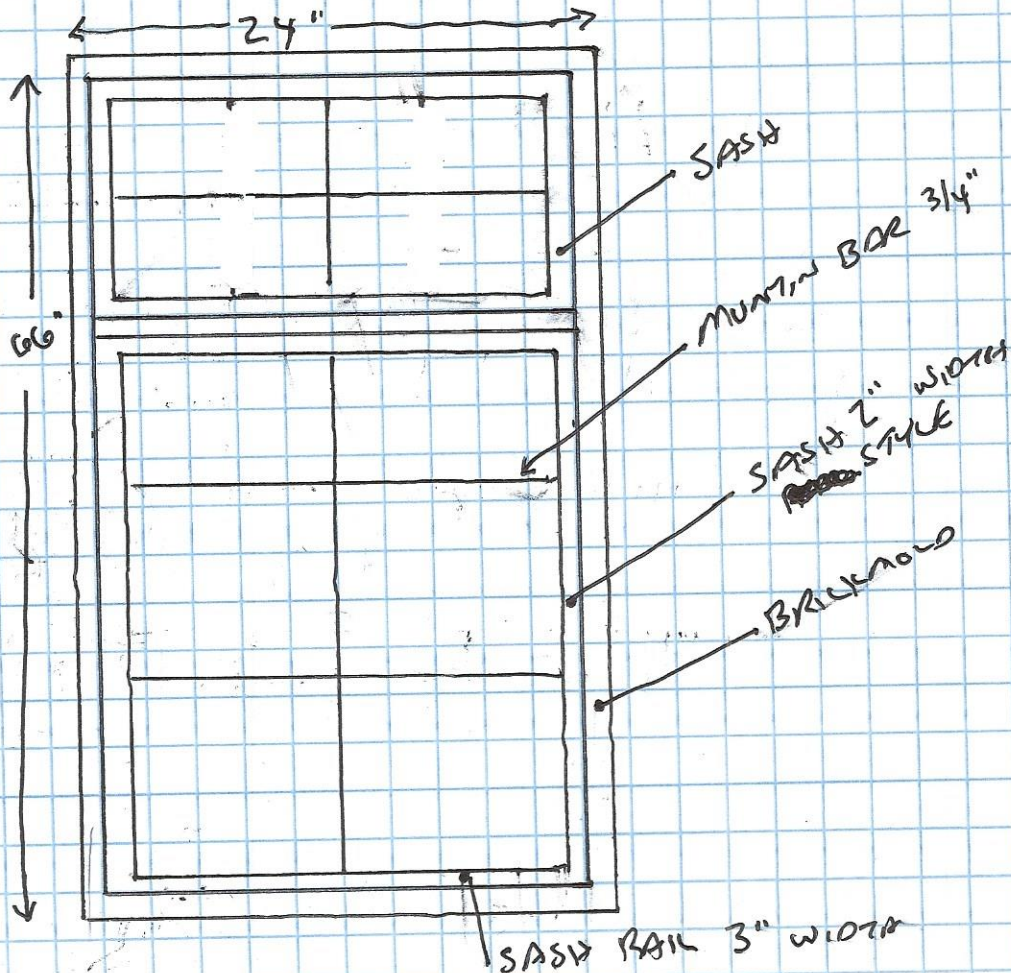


SASH RAIL 3" WIDTH

# LIVING ROOM SIDE A

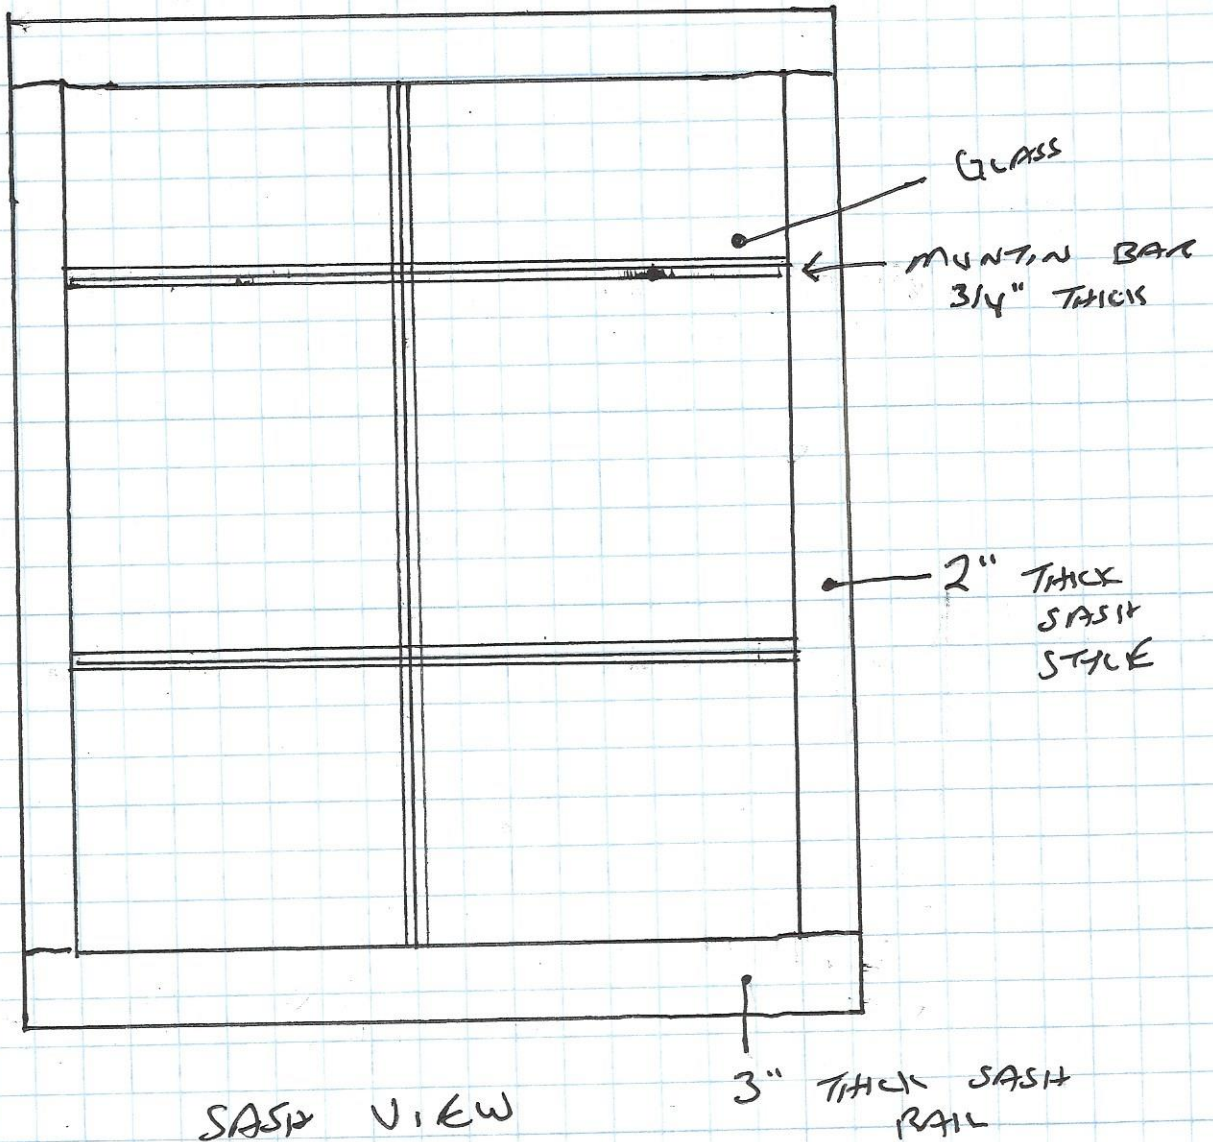


## SASH VIEW

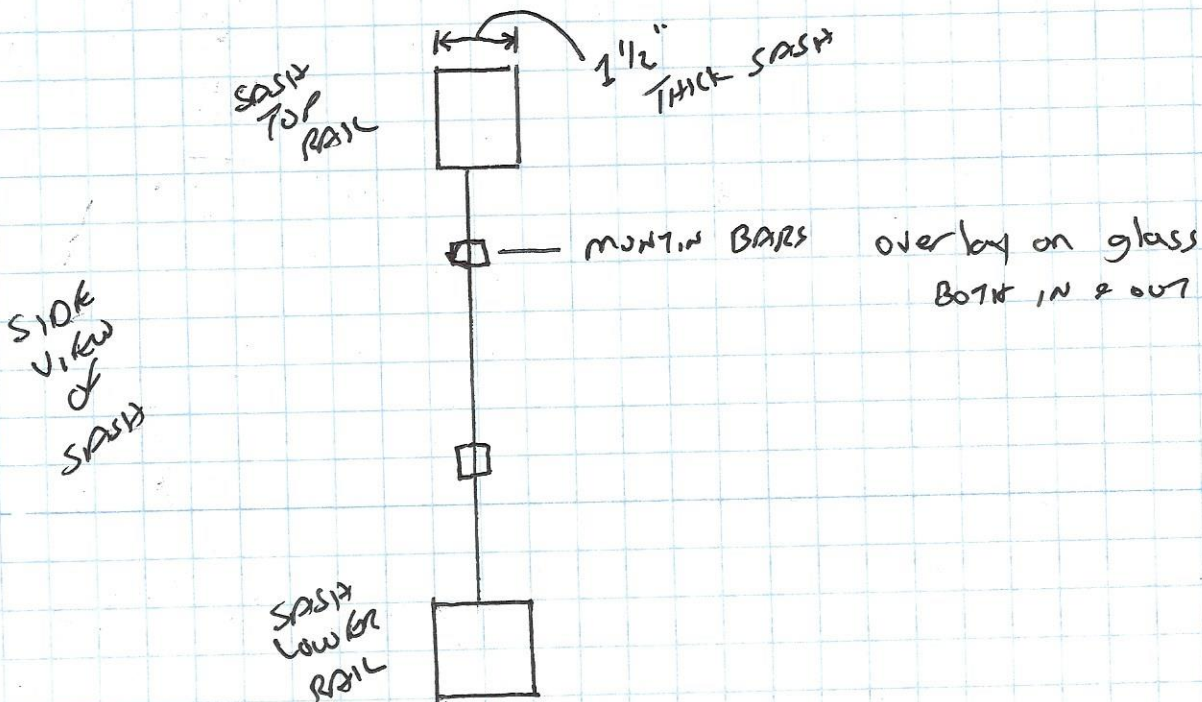



# Family Room / Living room 7

## 1<sup>st</sup> floor

- WINDOWS front & BACK of Room

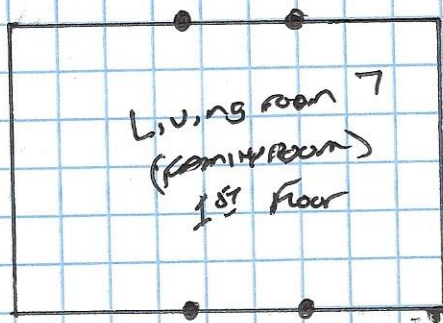


44' = FRONT ASIDE = 44'

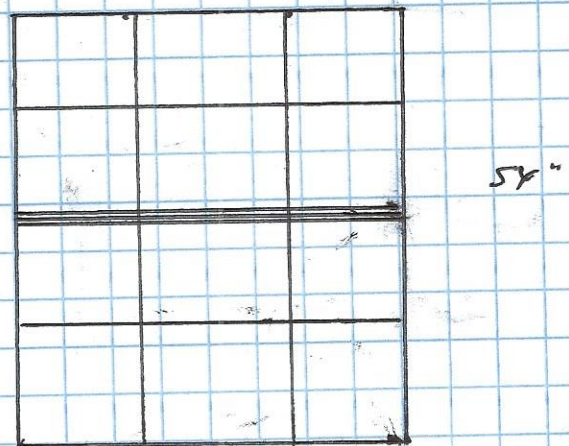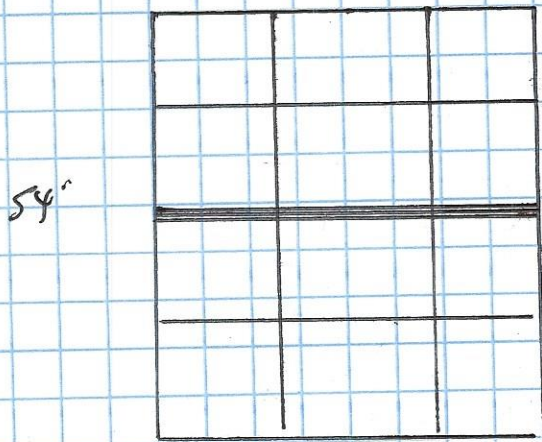


- These windows are set in brick openings
- Brick mold varies on perimeter from 1 1/2" - 2" in width
- New units will be within 3/8" of original frame
- Sash frames & glass type are the same as all others
- Mullion bars are laid on glass on both sides  
3/4" width. new will be 7/8" width & size.  
New will also lay on glass.

# KITCHEN - Rear 1<sup>st</sup> floor

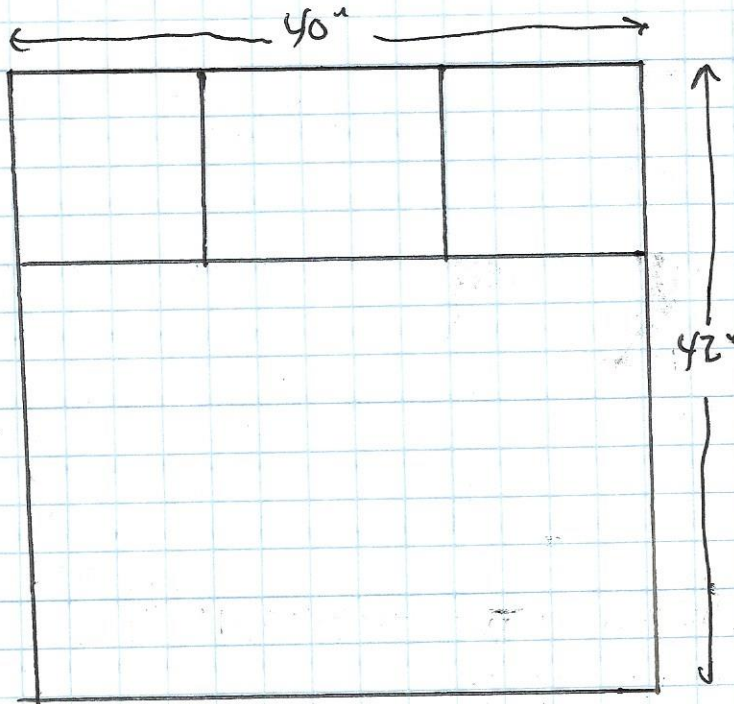

- Brick opening
- Colored muntin bars on upper sash only
- Brick mold varying from 1 1/4" - 2" on sides.
- No trim is painted white
- No storm window is present. Broken & missing

40/100  
1 2/3  
Double  
Hung

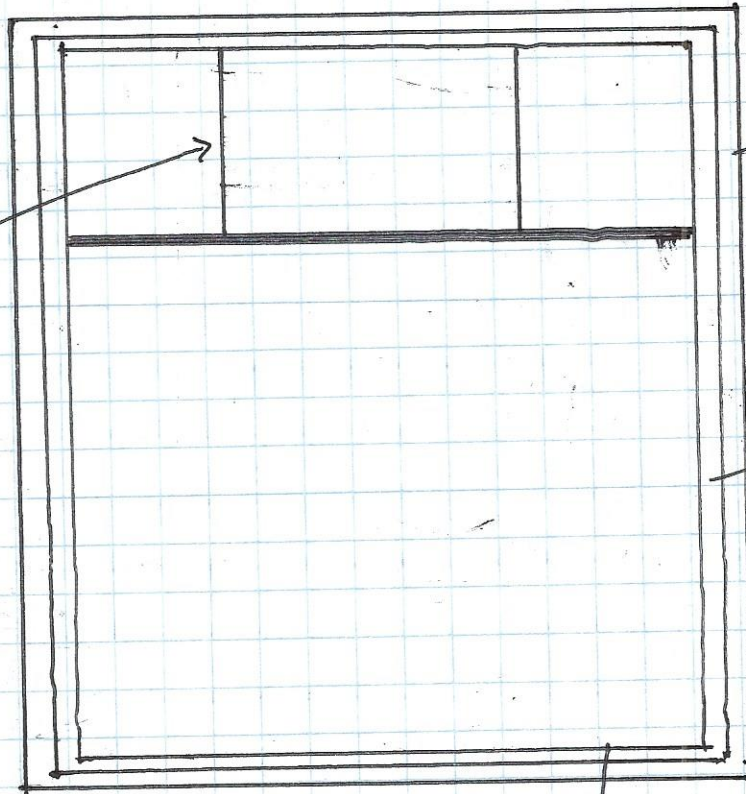

Muntin bars  
colored sash  
3/4" each


BRICK MOLD VARIES  
IN SIZE

SASH  
STAKE  
2"

SASH RAKE 3"


1/2 BATH = 1<sup>st</sup> FLOOR REAR

24"

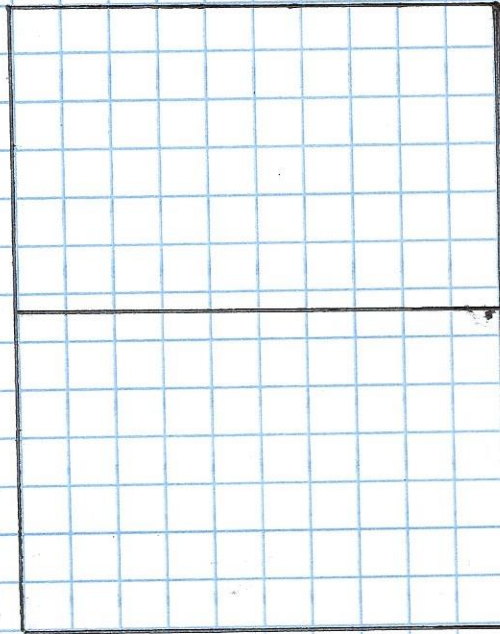

- Double Hung Unit
- Glass has been changed over the years. ↳ no longer has metal bars / colored bars on glass

- This window is on 1<sup>st</sup> floor rear side D
- Brick opening
- No storm window on ext<sup>o</sup>
- Security Bars will be taken off

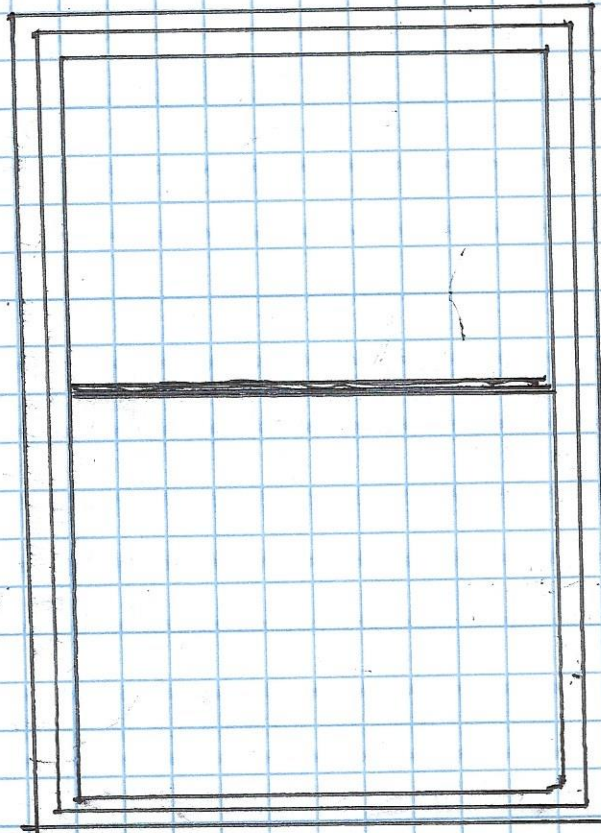


- Current glass has an obscure film stuck to glass to frost glass

- original would have had colored grids / window bars


- Brick mold varies on thickness of 1 1/4 - 1 3/4"
- SASH frame is the same as all others
- new units will have original ~~bars~~ & colored grids put back on glass

# DINING ROOM - 1<sup>ST</sup> FLOOR

24' REAR SIDE C 24'

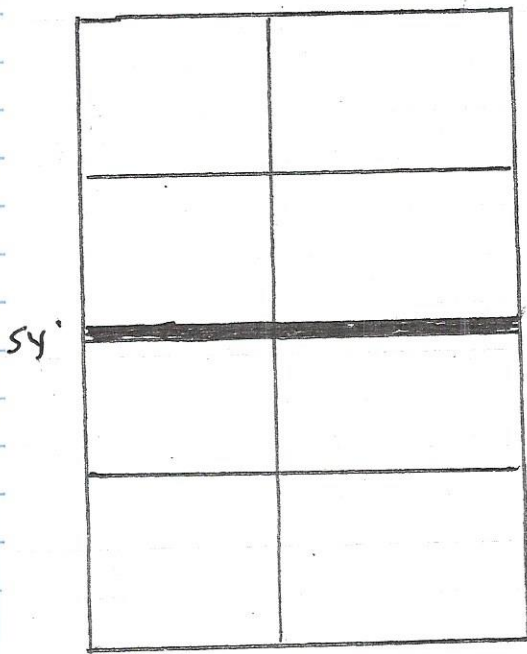

Pinyon

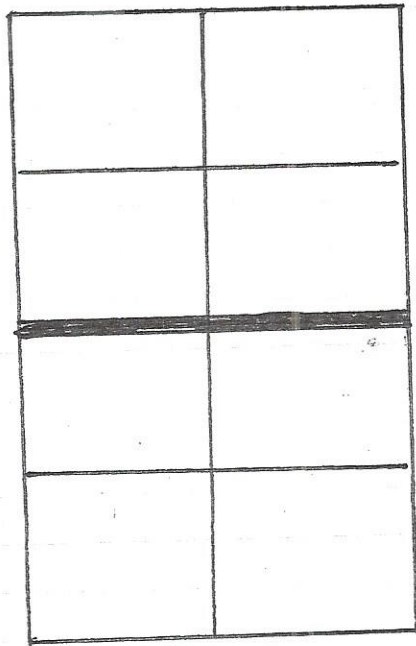


Pinyon

- These window units are in Brick openings
- Brickmole varies  $1\frac{1}{2}$  - 2" in dimension on perimeter
- Colored muntin bars laid on glass  $3\frac{1}{4}$ " wide
- Aluminum storm doors are broke & poor condition, missing parts

- New units will be within  $3\frac{1}{8}$ " of original size on all sides of frame


- Brickmole varies from  $1\frac{1}{4}$ " - 2" on sides

- Sash frames are the same as others.

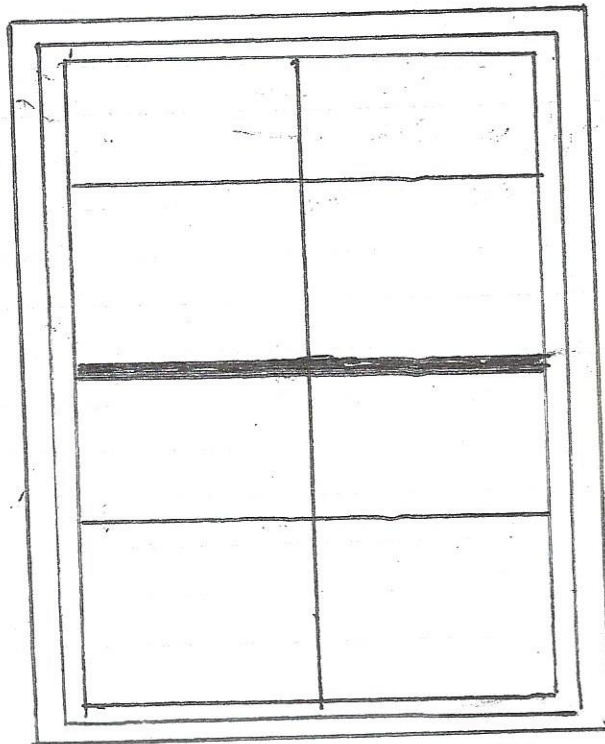


- muntin bars are laid on glass
- ↳ new units will have muntin bars on glass.  $7\frac{1}{8}$ " in width

# FRONT UPPER BEDROOMS - SIDE A



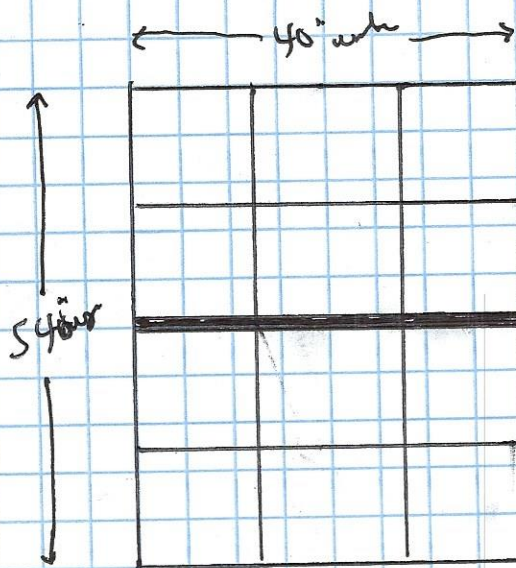


COLONIAL  
MUNTIN STYLE  
BARS  
ON  
UNITS  
6/6

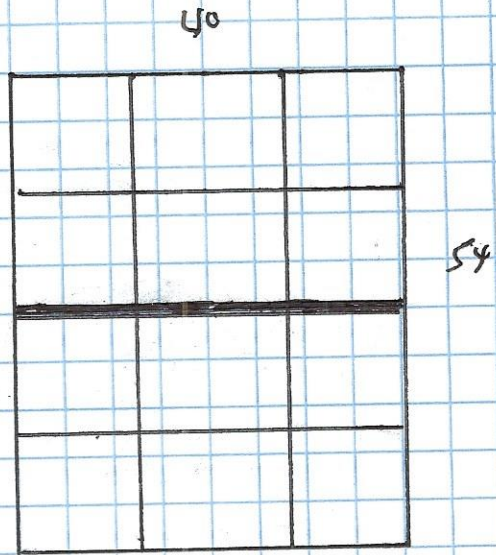

- Double Hung 50/50
- Brick molo is wrapped with aluminum trim coil
- Perimeter of windows is BUTTERED w/ Aluminum siding
- Window TRIM & SIDING are white aluminum

- New units will be within 3/8" of sink on all edges of frame

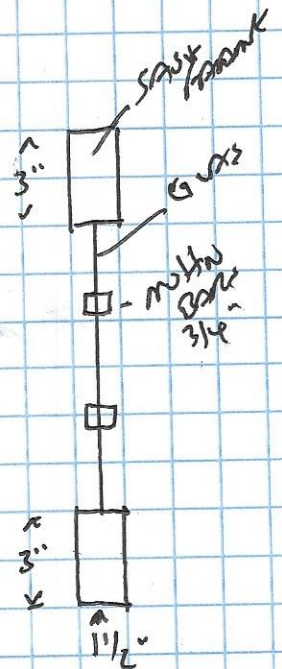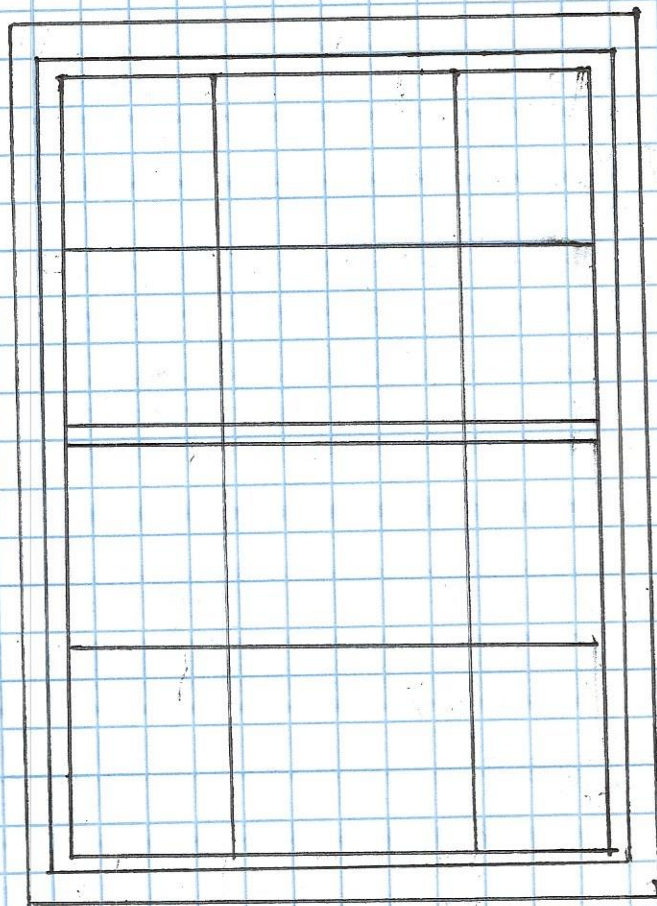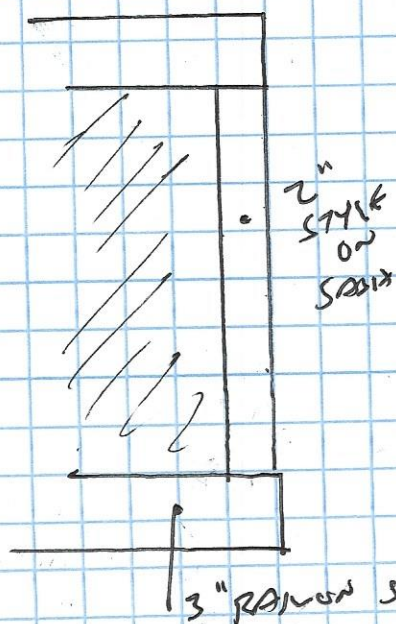


# Upper Side D

(on Right View from front)


28"

28"

34"

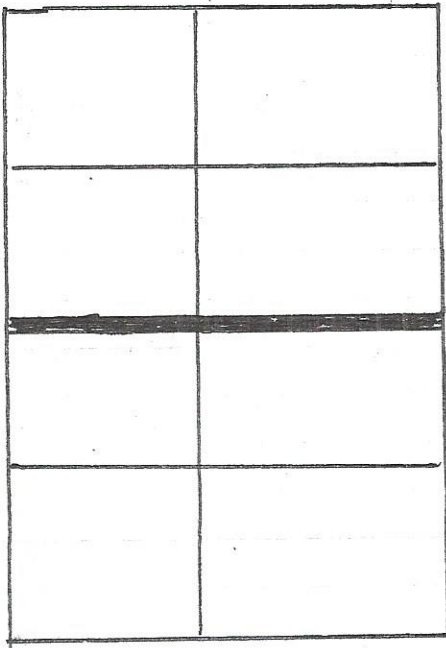

Bedroom 13

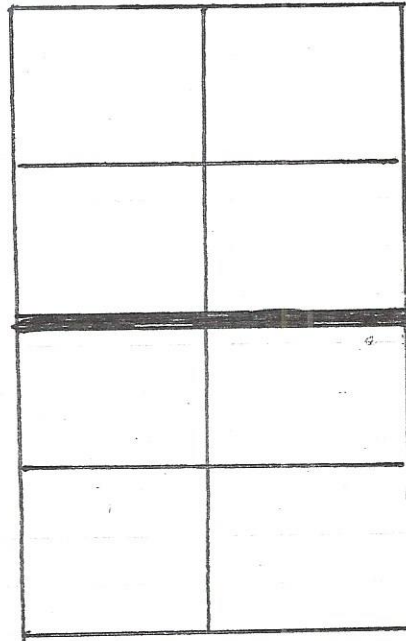

34"


stairs up

- These window units are in Brick openings
- Brick mullion varies  $1\frac{1}{2}$  - 2" in dimension on perimeter
- Colored muntin bars Laid on glass  $3\frac{1}{4}$ " wide
- Aluminum storm doors are broke & poor condition, missing parts

- New units will be within  $3\frac{1}{8}$ " of original size on all sides of frame

- Brick mullion varies from  $1\frac{1}{4}$ " - 2" on sides

- Storm frames are the same as others.

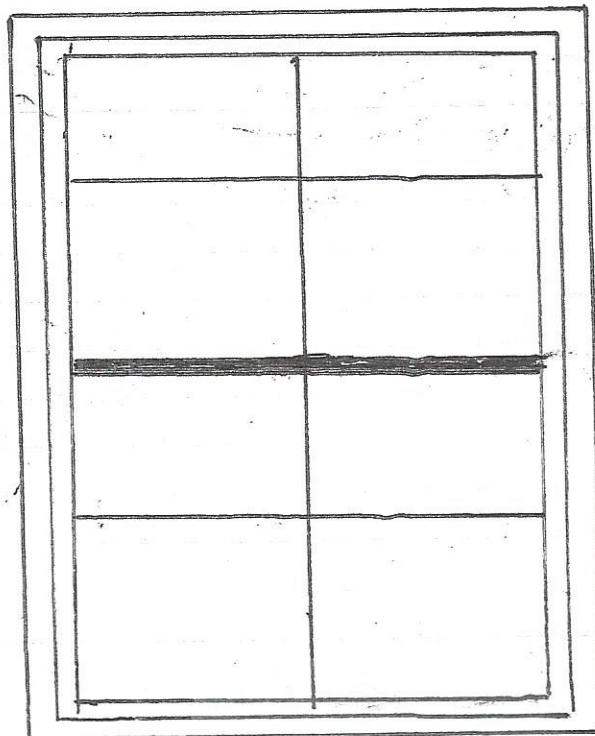

- mullin bars are Laid on glass

- ↳ New units will have mullin bars on glass.  $7\frac{1}{8}$ " in width




(LEFT AS VIEWED FROM FRONT)

# SIDE B - UPPER


28"

28"

34"

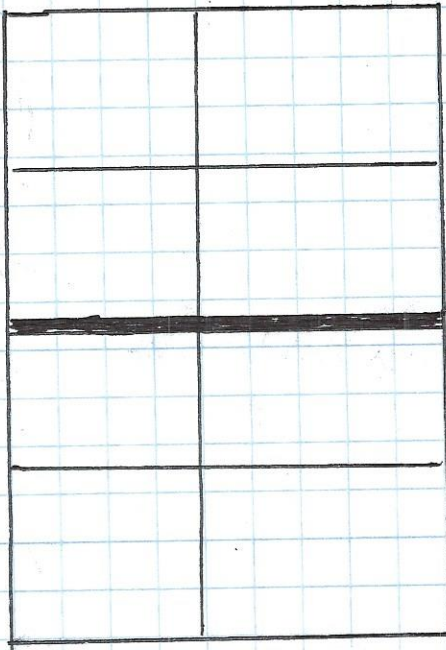

Bedroom 12

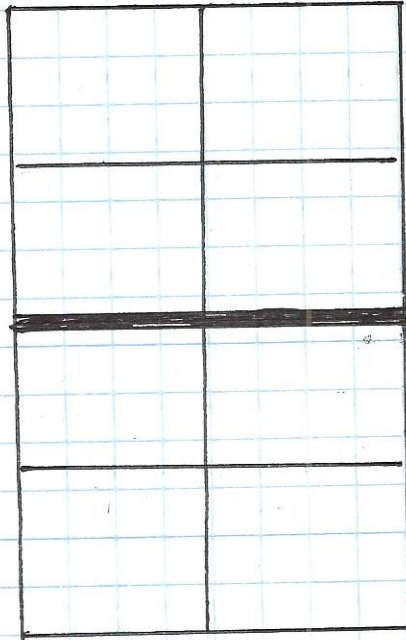


Bedroom 11

- These window units are in Brick openings
- Brick mullion varies  $1\frac{1}{2}$  - 2" in dimension on perimeter
- colored muntin bars laid on glass  $3\frac{1}{4}$ " wide
- Aluminum storm doors are broke & poor condition, missing parts

• New units will be within  $3\frac{1}{8}$ " of original size on all sides of frame

• Brick mullion varies from  $1\frac{1}{4}$ " - 2" on sides

• SASH frames are the same as others.

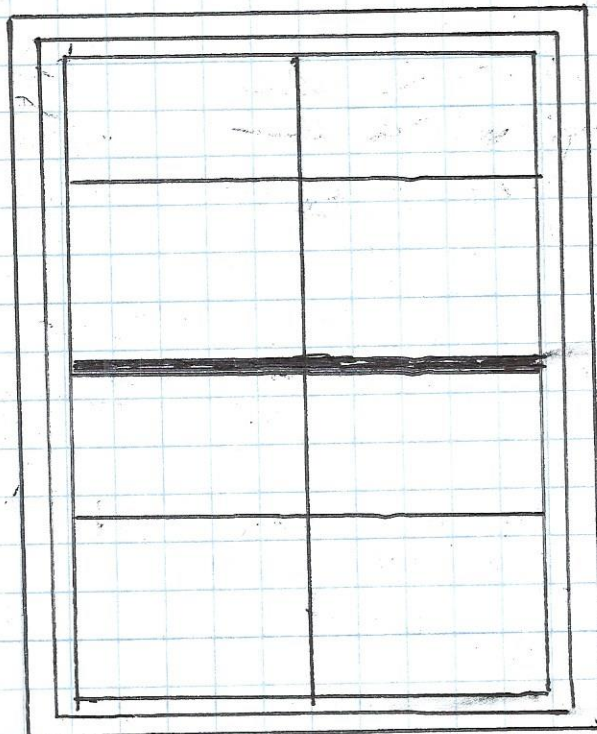

• Muntin bars are laid on glass

↳ New units will have muntin bars on glass.  $7\frac{1}{8}$ " in width