
THE RECTORY

DHDC SET 4/24/2023



TABLE OF CONTENTS

HDC APPROVED SITE PLAN	PAGE	7
REVISED SITE PLAN	PAGE	2
HDC APPROVED ELEVATIONS	PAGE	3
HDC APPROVED ELEVATIONS	PAGE	4
REVISED ELEVATIONS	PAGE	5
REVISED ELEVATIONS	PAGE	6
HDC APPROVED SCHEDULE	PAGE	7
EXISING SITE PHOTOS	PAGE	8
EXISTING ELEVATION PHOTOS	PAGE	9
EXISTING ELEVATION PHOTOS	PAGE	10
EXISTING DETAILS PHOTOS	PAGE	77
EXISTING DETAILS PHOTOS	PAGE	12
CUT SHEETS	PAGE	13

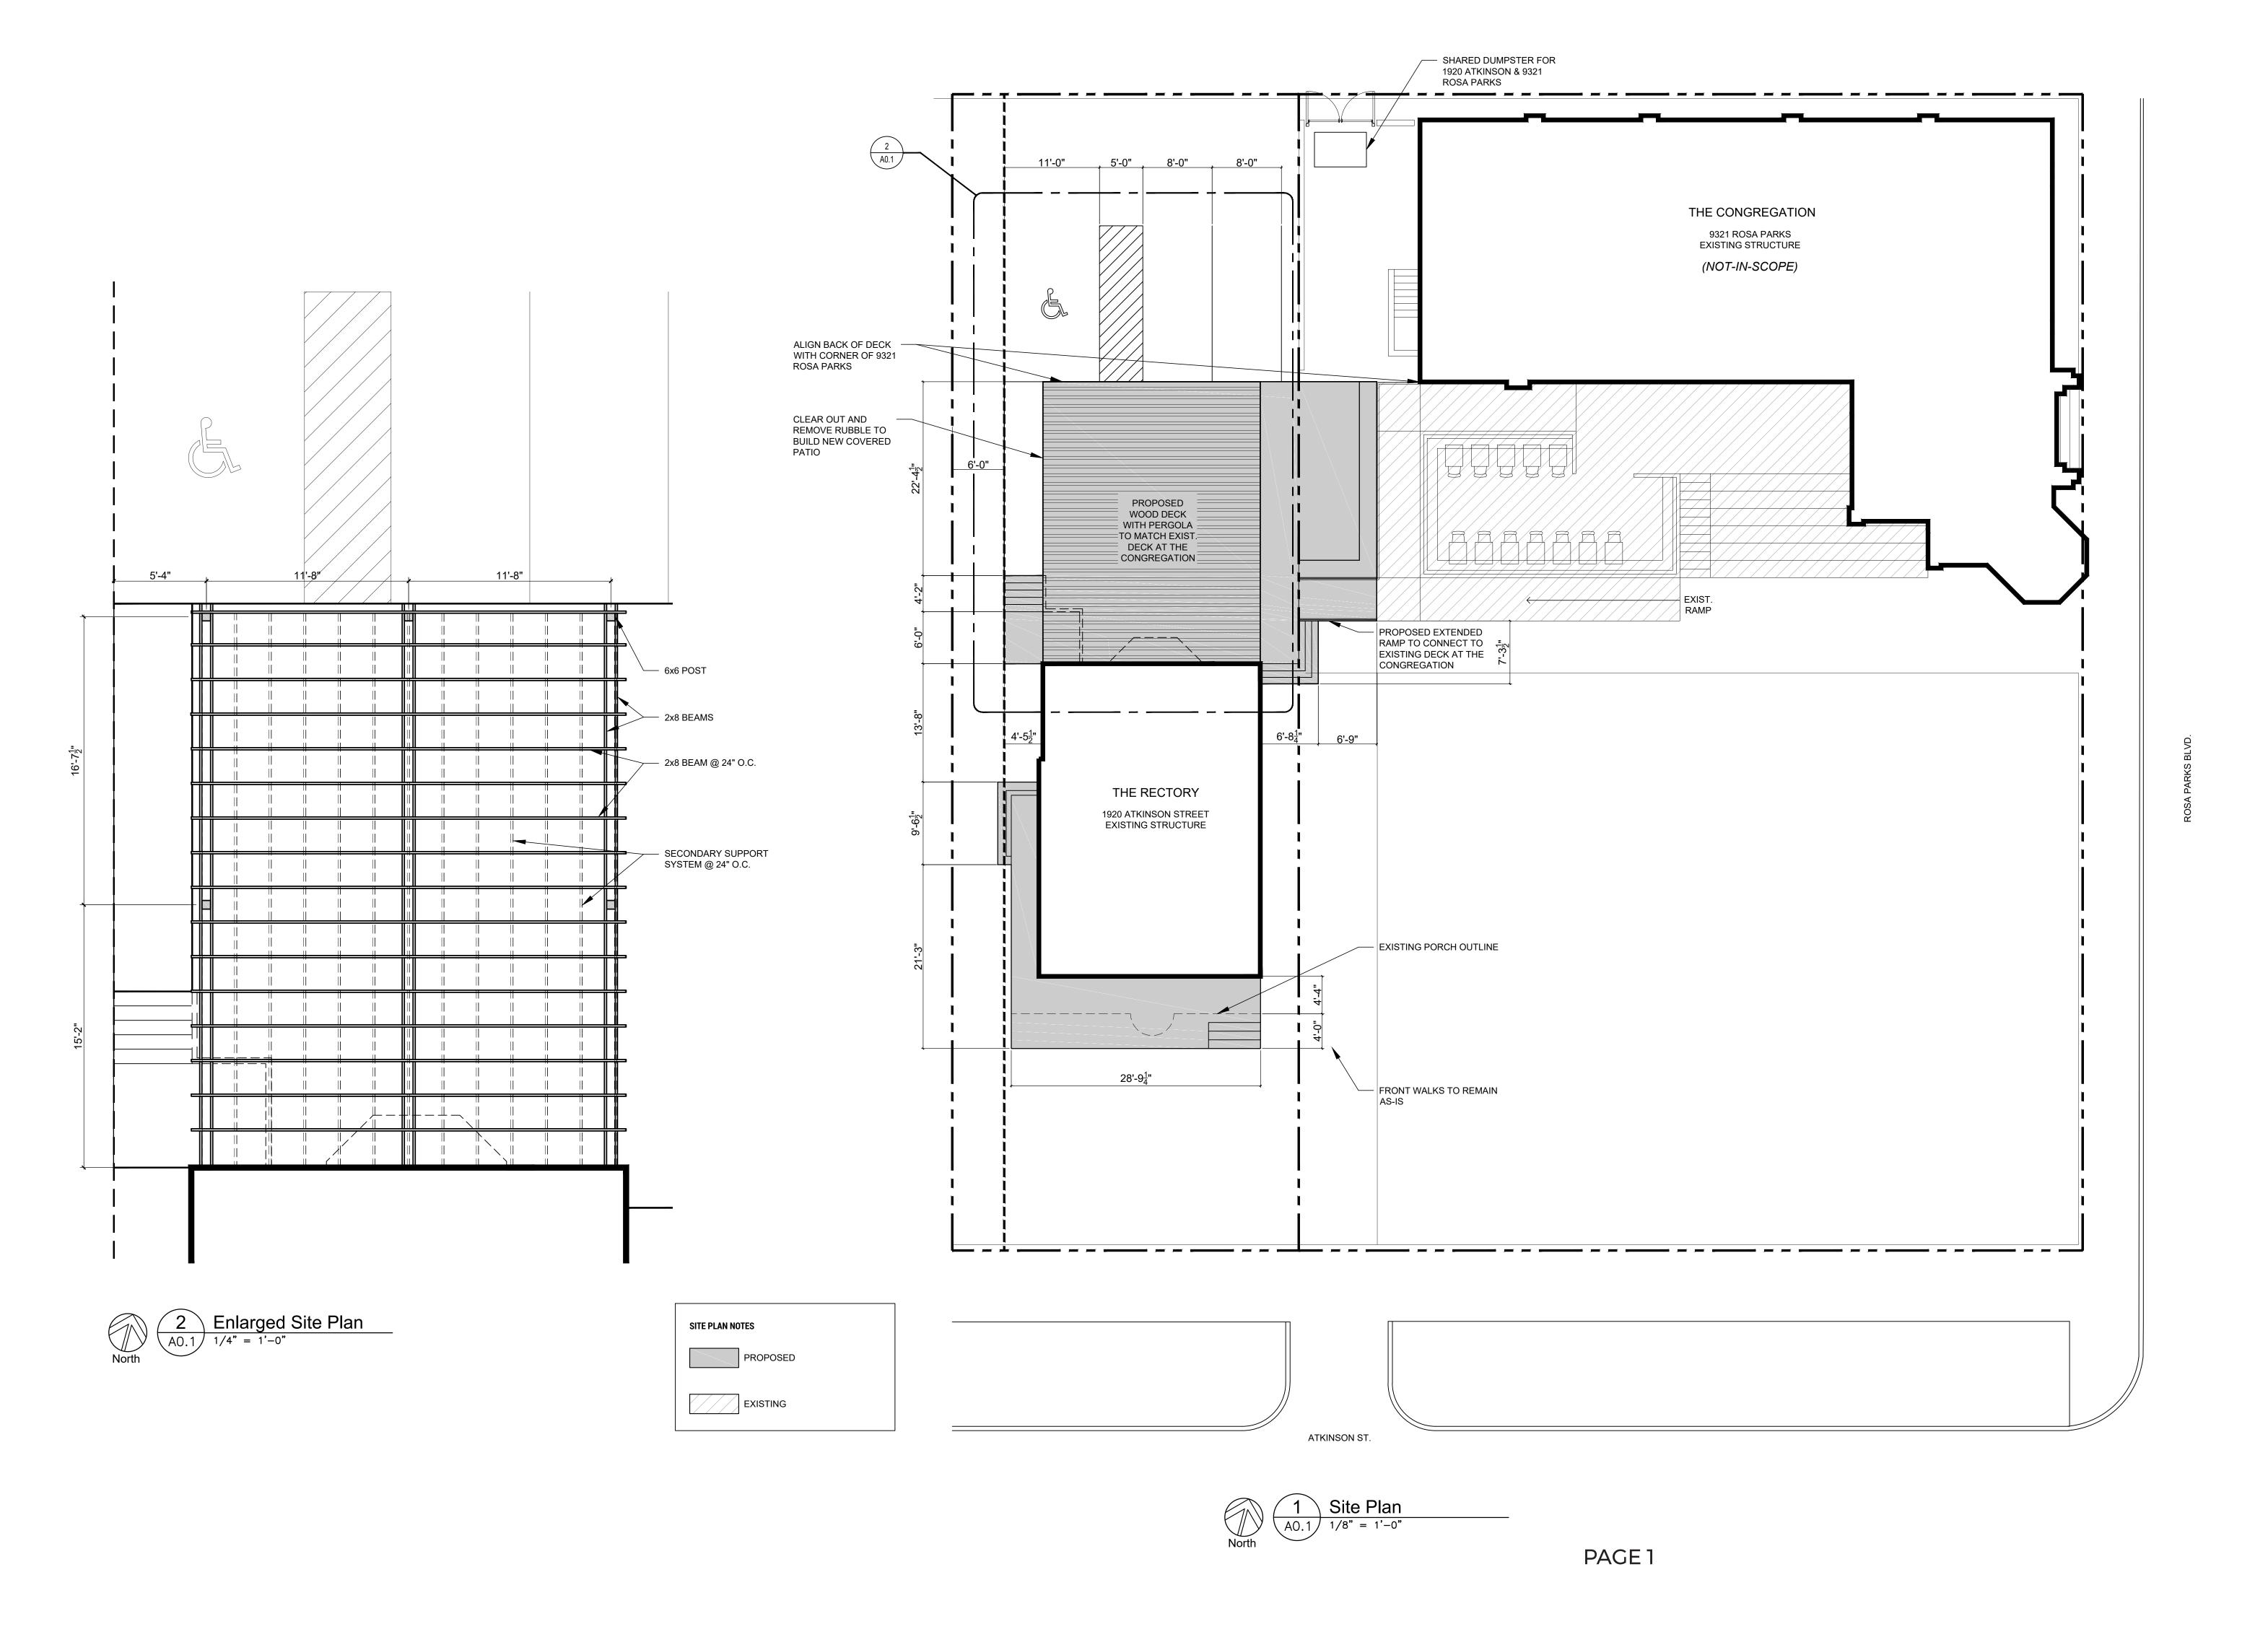

lannuzzi Studio architecture + design

1410 Service St. Suite 202 Detroit, MI 48207

> T. 313.625.9500 lannuzziStudio.com

PROJECT:

The Rectory 1920 Atkinson St. Detroit, MI 48206

- 12 - 2021 HDC Set


SHEET NUMBER:

AO.1

SHEET TITLE:
ARCHITECTURAL
SITE PLAN
© lannuzzi Studio PLLC 2019

ZONED R1-H (NOT-IN-SCOPE)

PUBLIC ALLEY (20' WD.)

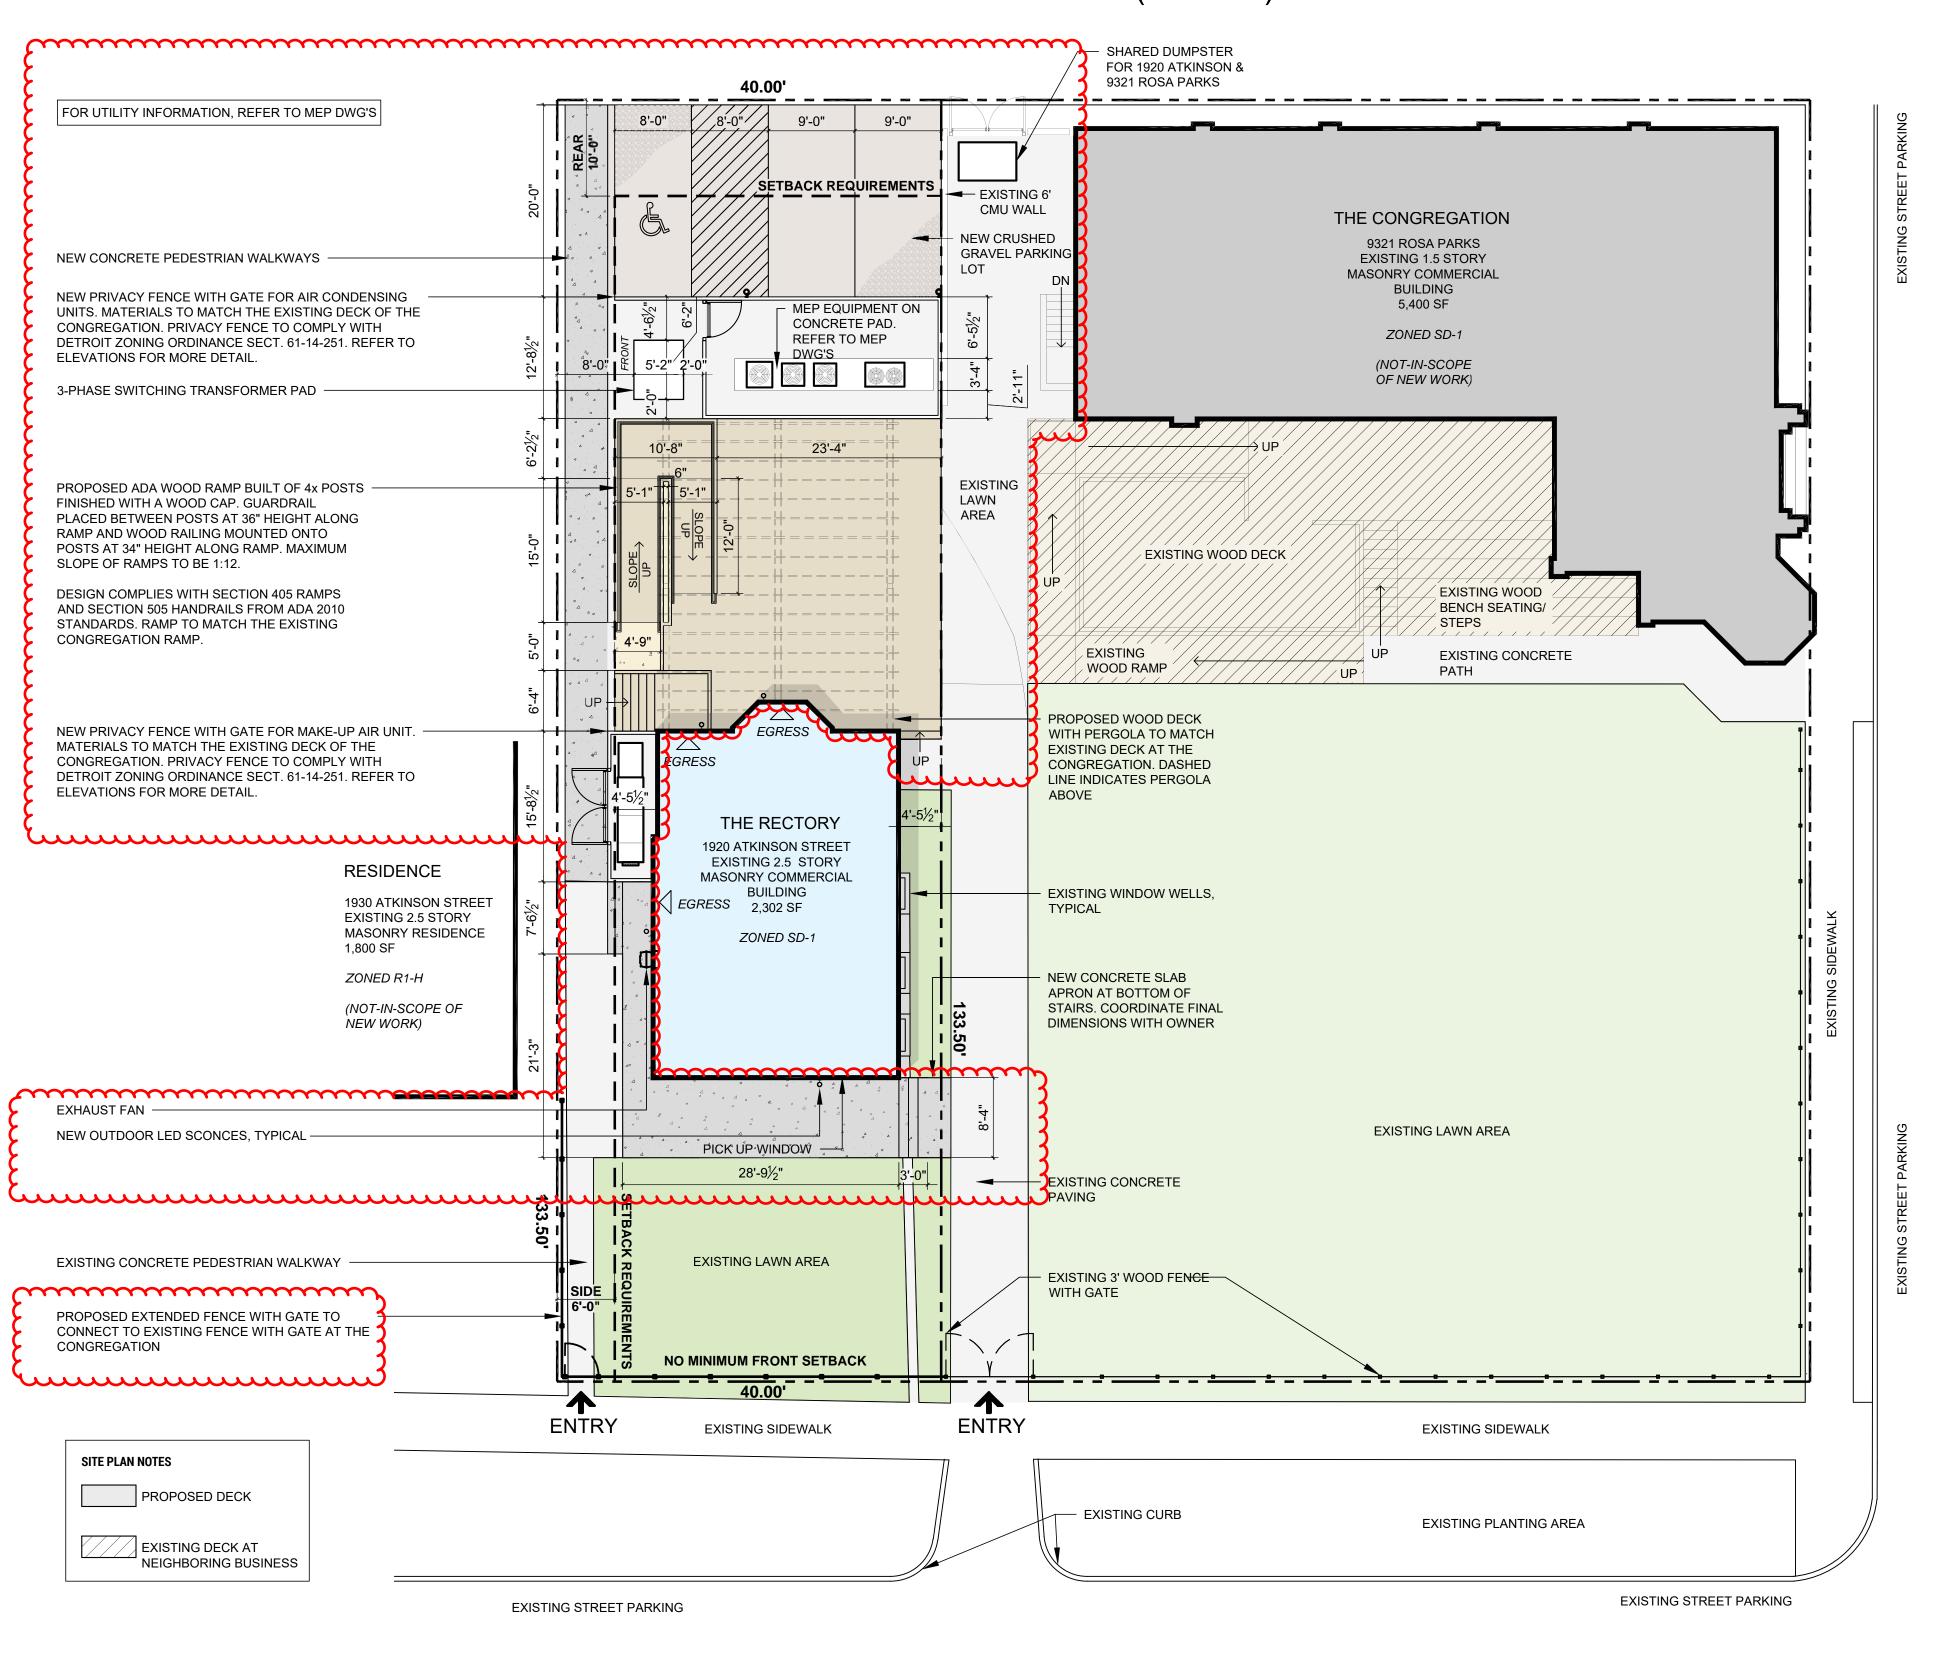

ATKINSON ST. (66' R.O.W.)




EMPTY LOT ZONED SD-1 Detroit, MI 48207 T. 313.625.9500 lannuzziStudio.com PROJECT: 1920 Atkinson St. Detroit, MI 48206 <u>11 - 24 - 2021</u> Owner Review 04 - 22 - 2022 Owner Review <u>11 - 15 - 2022</u> Site Plan Approval <u>11 - 17 - 2022</u> **Building Permit** 04 - 17 - 2023 Permit Revision

04 - 24 - 2023

SHEET NUMBER:

ARCHITECTURAL

SITE PLAN
© Iannuzzi Studio PLLC 201

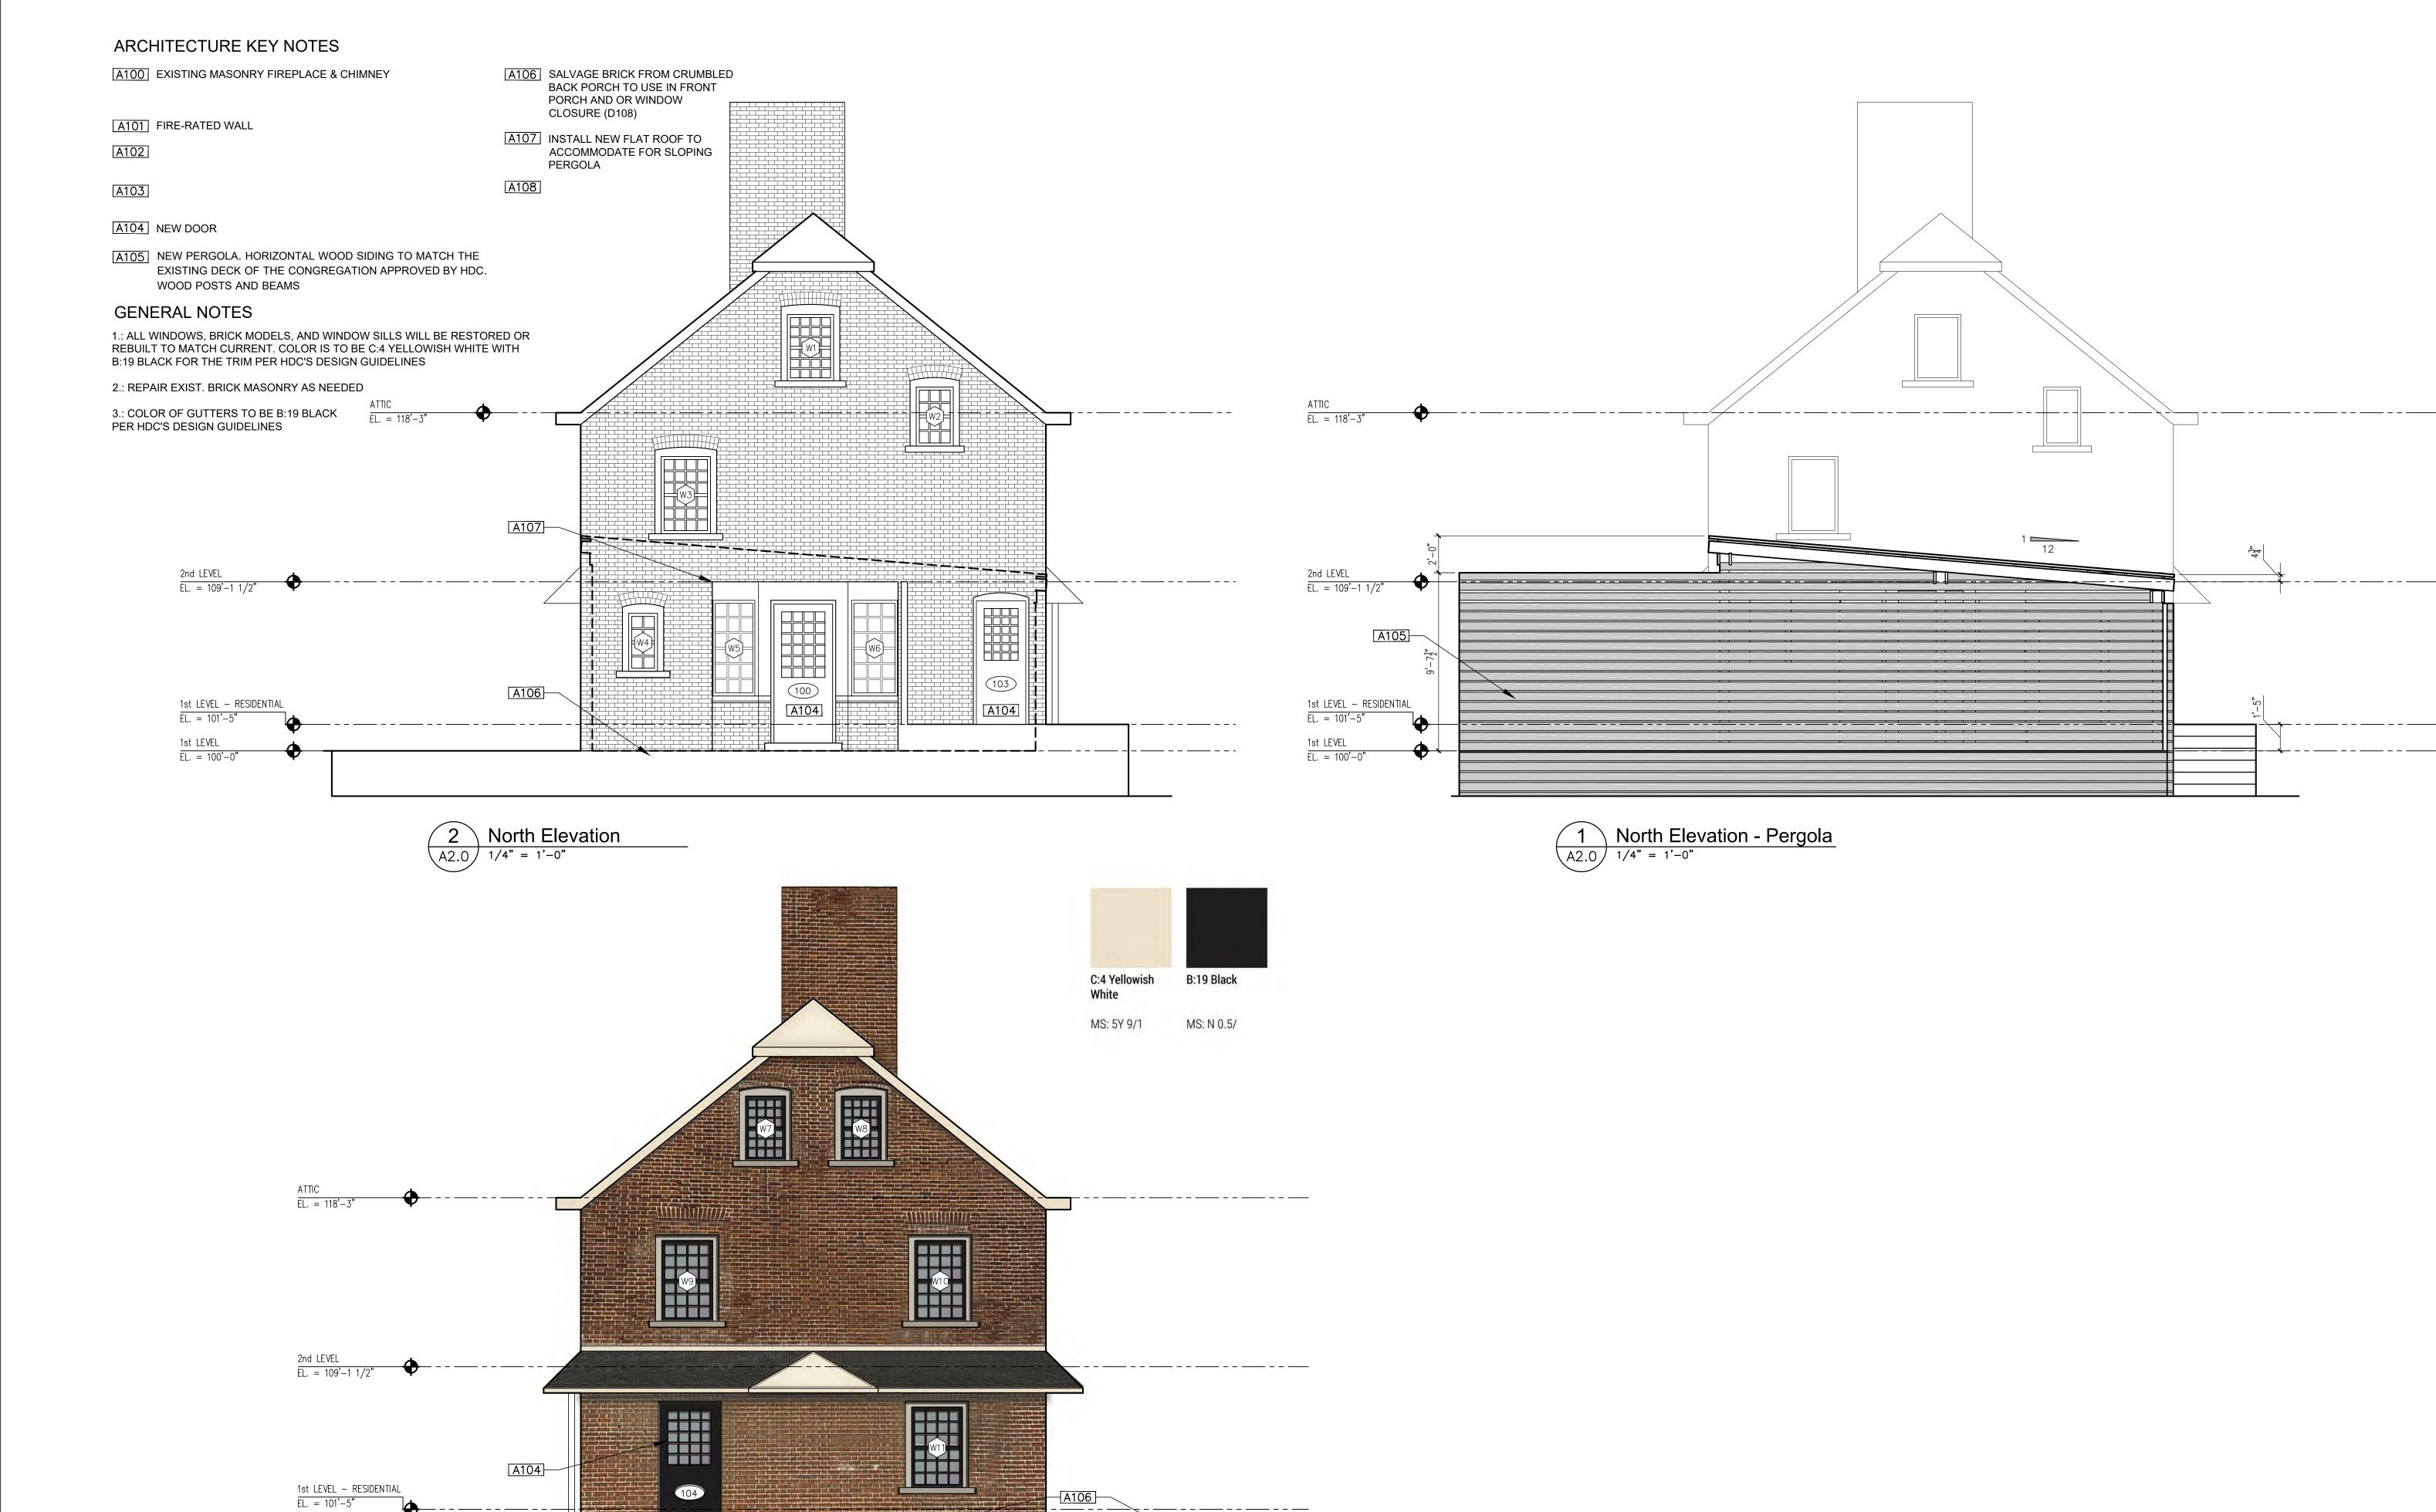

NEW BRICK PORC BEYOND

 $\frac{1st LEVEL}{EL. = 100'-0"}$

3 South Elevation
A2.0 1/4" = 1'-0"

lannuzzi Studio Architecture + design

> 1410 Service St. Suite 202 Detroit, MI 48207

> > T. 313.625.9500 lannuzziStudio.com

PROJECT:

The Rectory 1920 Atkinson St. Detroit, MI 48206

04 - 12 - 2021 HDC Set

SHEET NUMBER:

A2.0

SHEET TITLE: PROP. EXTERIOR

ELEVATIONS
© Iannuzzi Studio PLLC 2019

A100 EXISTING MASONRY FIREPLACE & CHIMNEY

A106 SALVAGE BRICK FROM CRUMBLED BACK PORCH TO USE IN FRONT PORCH AND OR WINDOW CLOSURE (D108)

A101 FIRE-RATED WALL

A107

A102

A103

A104 NEW DOOR


A105 NEW PERGOLA. HORIZONTAL WOOD SIDING TO MATCH THE EXISTING DECK OF THE CONGREGATION APPROVED BY HDC. WOOD POSTS AND BEAMS


GENERAL NOTES

1.: ALL WINDOWS, BRICK MODELS, AND WINDOW SILLS WILL BE RESTORED OR REBUILT TO MATCH CURRENT. COLOR IS TO BE C:4 YELLOWISH WHITE WITH B:19 BLACK FOR THE TRIM PER HDC'S DESIGN GUIDELINES

2.: REPAIR EXIST. BRICK MASONRY AS NEEDED

3.: COLOR OF GUTTERS TO BE B:19 BLACK PER HDC'S DESIGN GUIDELINES

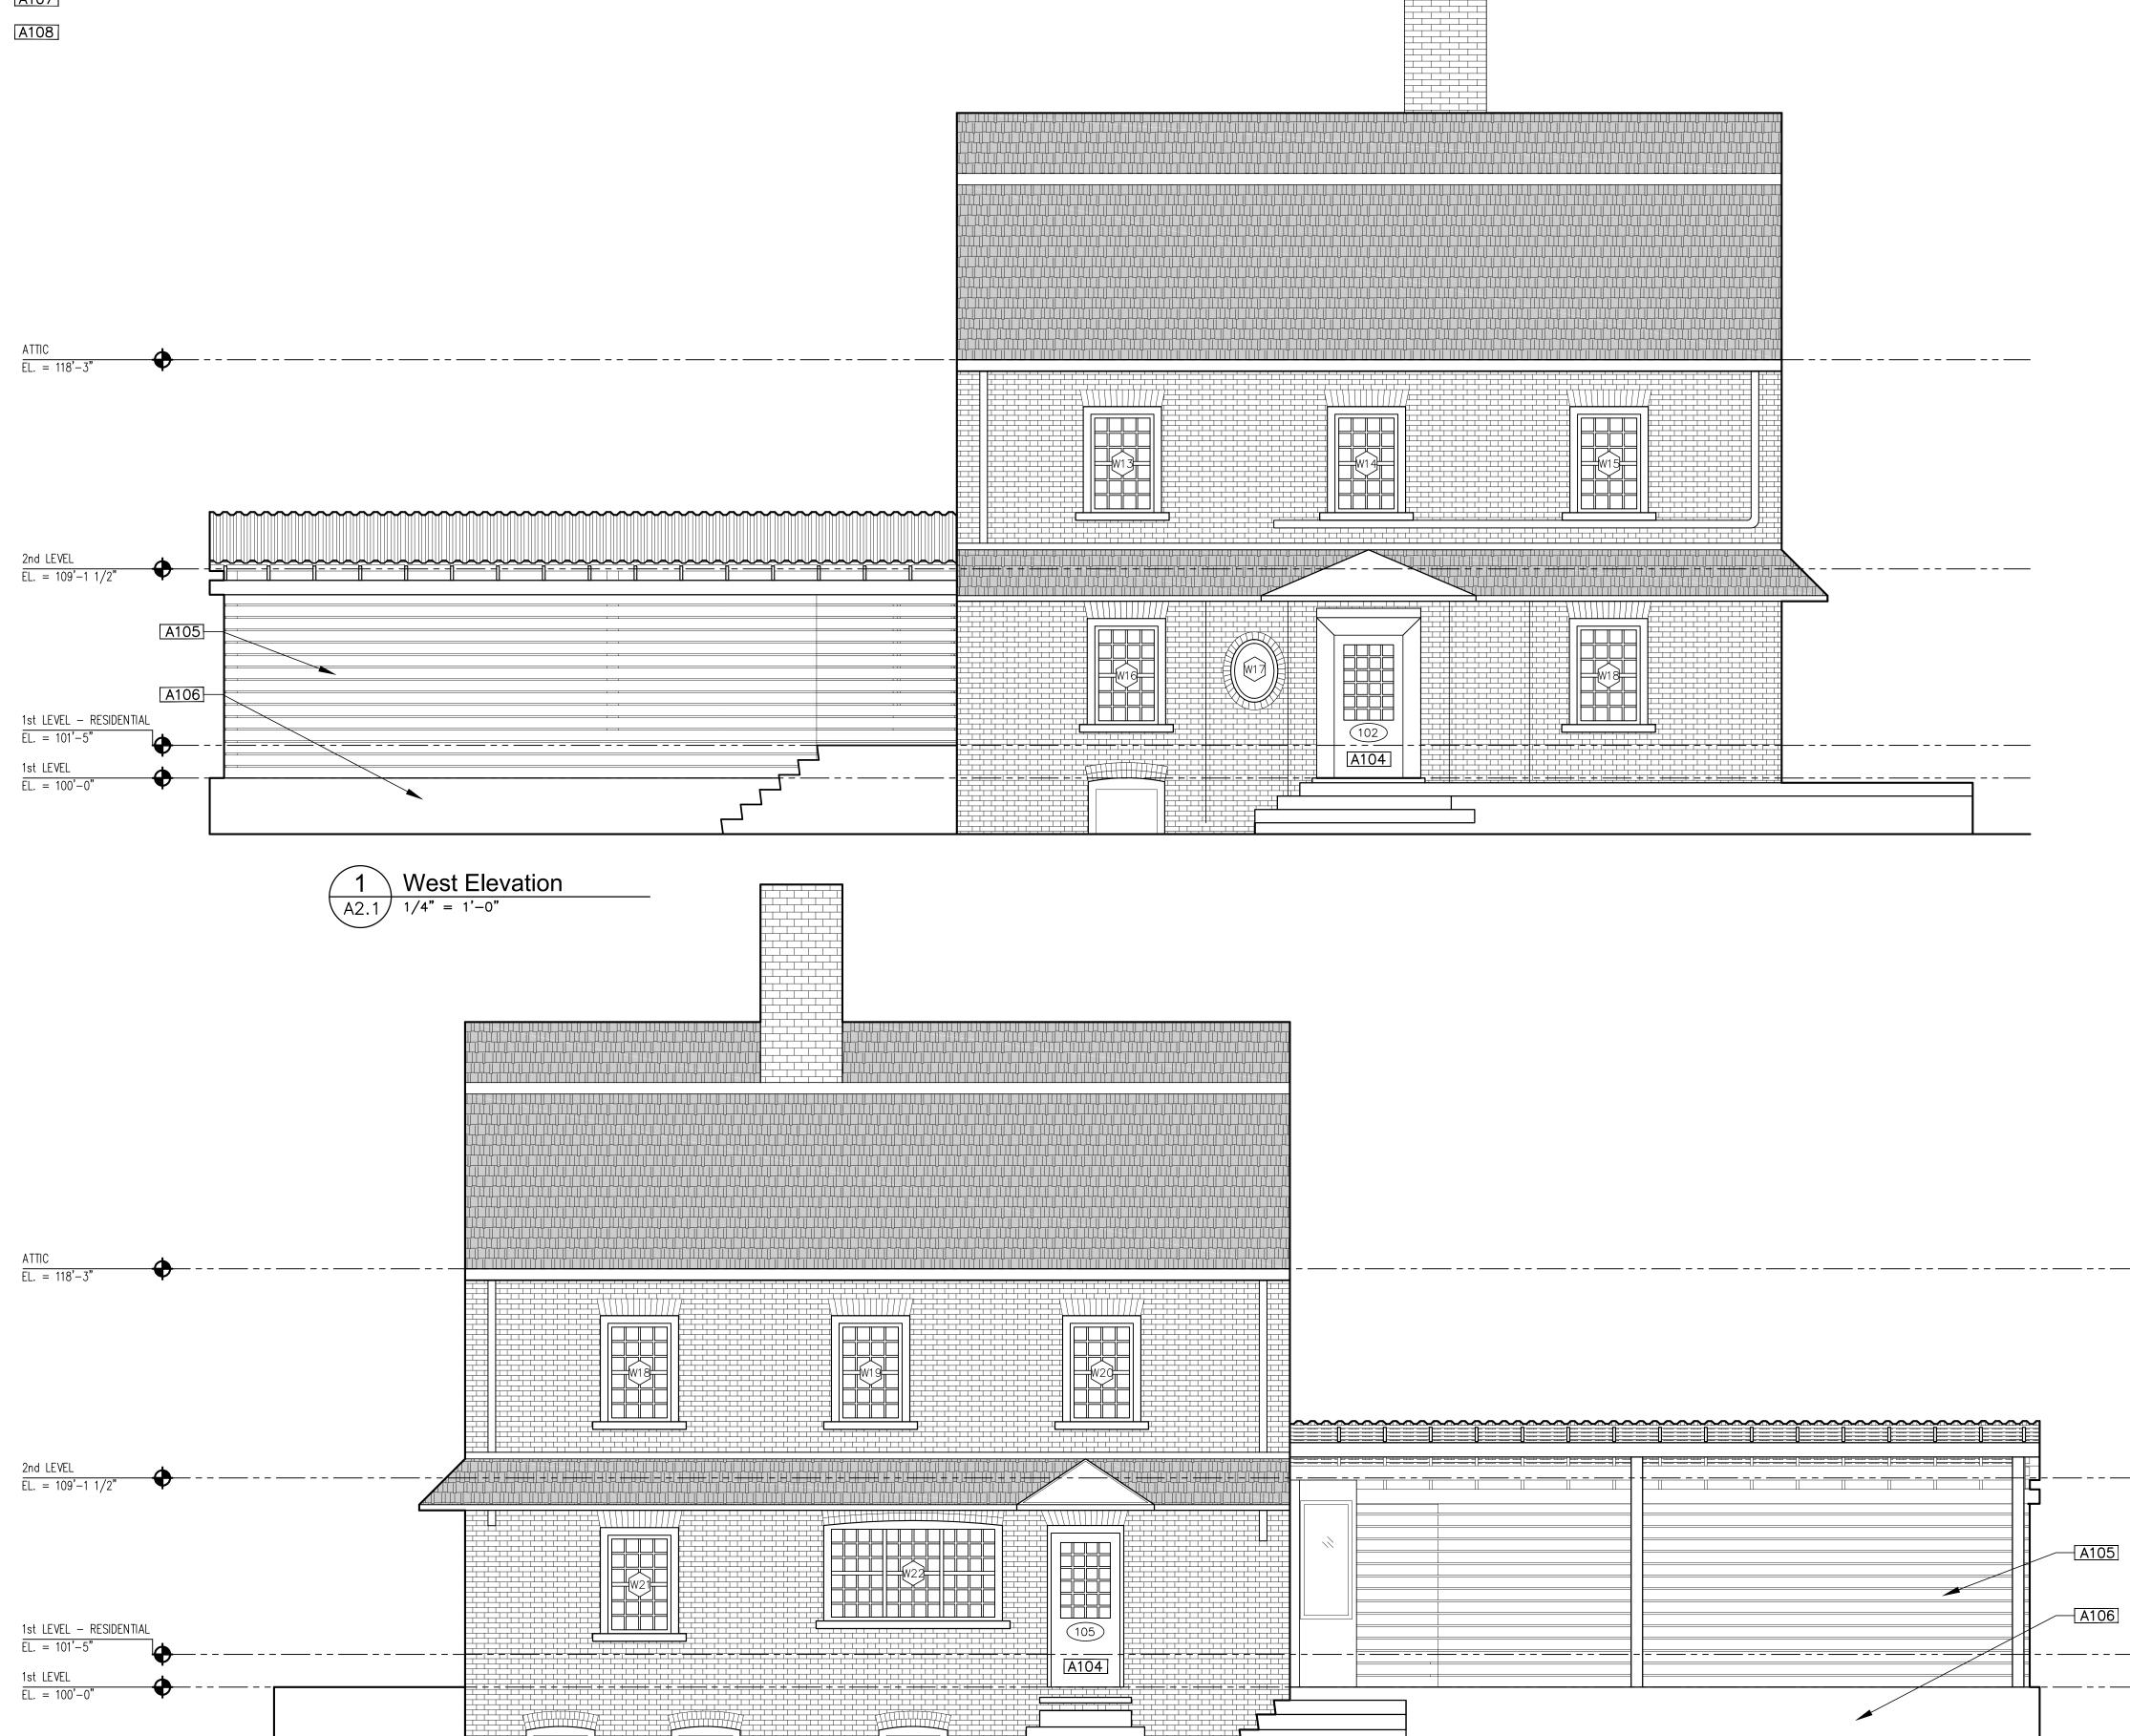



ARCHITECTURE + DESIGN

1410 Service St. Suite 202 Detroit, MI 48207

T. 313.625.9500 lannuzziStudio.com

PROJECT:


The Rectory 1920 Atkinson St. Detroit, MI 48206

DATE:	ISSUED FOR:
04 - 12 - 2021	HDC Set

SHEET NUMBER:

A2.1

SHEET TITLE:
PROP. EXTERIOR
ELEVATIONS
© lannuzzi Studio PLLC 2019

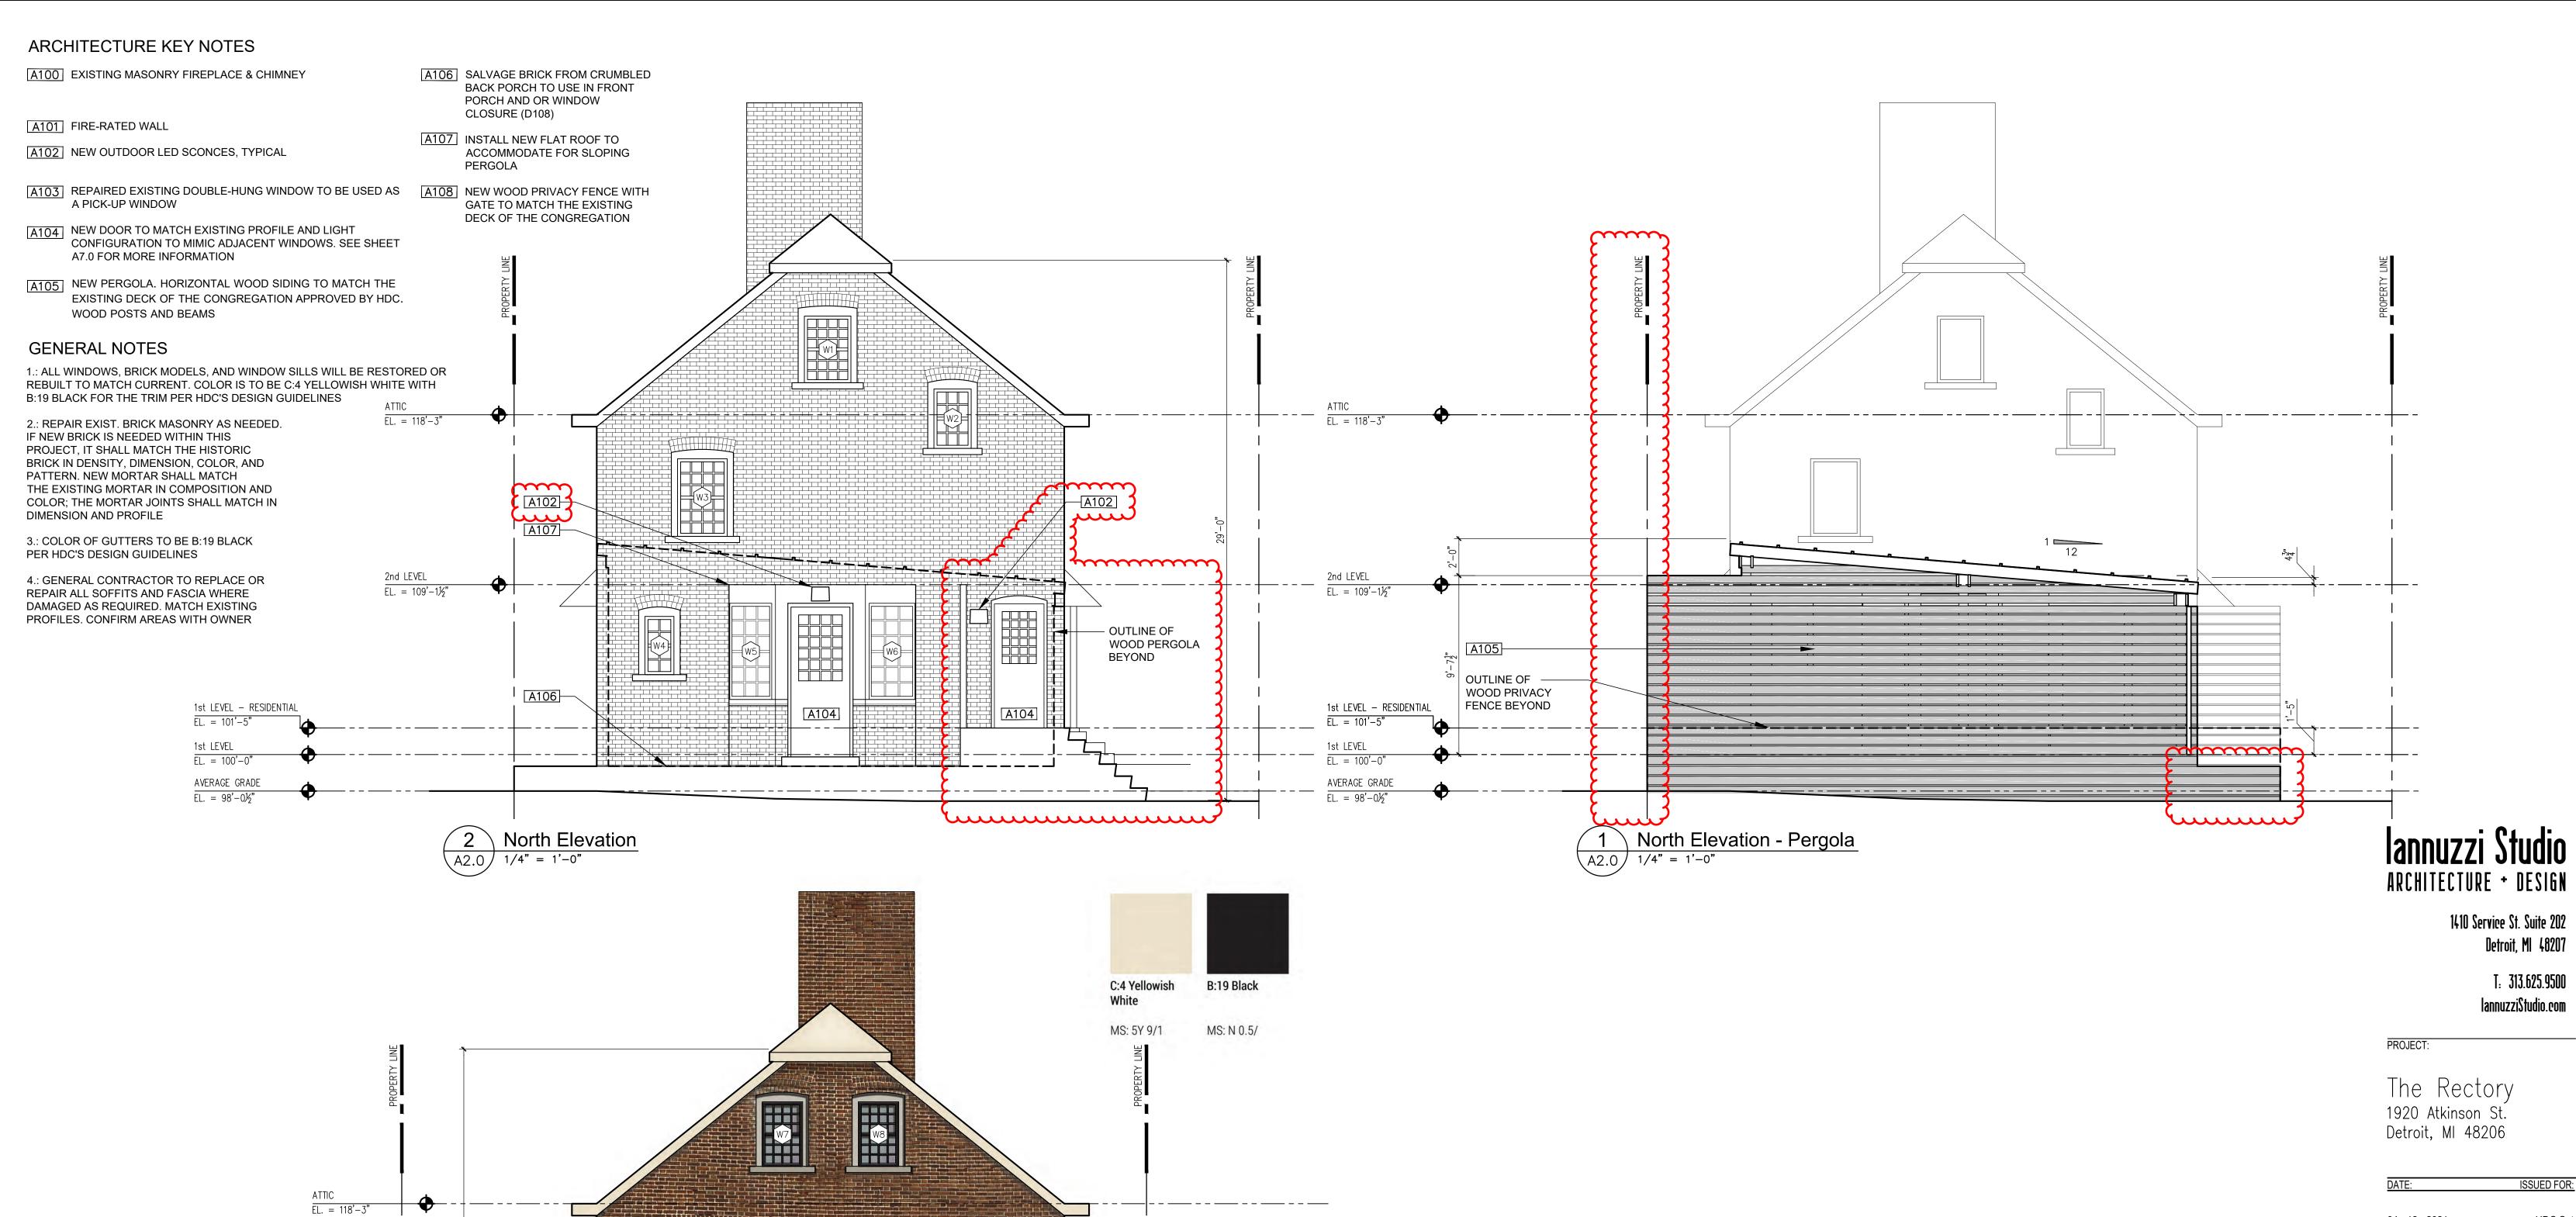

WIC

W11

A102

NEW BRICK PORCH BEYOND

w9 w9

A104

3 South Elevation
A2.0 1/4" = 1'-0"

 $\overline{EL.} = 109' - 1\frac{1}{2}"$

1st LEVEL - RESIDENTIAL

EL. = 101'-5"

 $\frac{1st LEVEL}{EL. = 100'-0"}$

 $\frac{\text{AVERAGE GRADE}}{\text{EL.} = 98' - 0\frac{1}{2}''}$

 04 - 12 - 2021
 HDC Set

 11 - 24 - 2021
 Owner Review

 04 - 22 - 2022
 Owner Review

 11 - 15 - 2022
 Site Plan Approval

 11 - 17 - 2022
 Building Permit

 04 - 17 - 2023
 Permit Revision

 04 - 24 - 2023
 HDC Set

SHEET NUMBER:

SHEET TITLE:
PROP. EXTERIOR
ELEVATIONS
© Ignnuzzi Studio PLLC 2019

ARCHITECTURE KEY NOTES

A100 EXISTING MASONRY FIREPLACE & CHIMNEY

A101 FIRE-RATED WALL

A102 NEW OUTDOOR LED SCONCES, TYPICAL

A103 PICK-UP WINDOW

A104 NEW DOOR TO MATCH EXISTING PROFILE AND LIGHT CONFIGURATION TO MIMIC ADJACENT WINDOWS. SEE SHEET A7.0 FOR MORE INFORMATION

A105 NEW PERGOLA. HORIZONTAL WOOD SIDING TO MATCH THE EXISTING DECK OF THE CONGREGATION APPROVED BY HDC. WOOD POSTS AND BEAMS

GENERAL NOTES

1.: ALL WINDOWS, BRICK MODELS, AND WINDOW SILLS WILL BE RESTORED OR REBUILT TO MATCH CURRENT. COLOR IS TO BE C:4 YELLOWISH WHITE WITH B:19 BLACK FOR THE TRIM PER HDC'S DESIGN GUIDELINES

2.: REPAIR EXIST. BRICK MASONRY AS NEEDED. IF NEW BRICK IS NEEDED WITHIN THIS PROJECT, IT SHALL MATCH THE HISTORIC BRICK IN DENSITY, DIMENSION, COLOR, AND PATTERN. NEW MORTAR SHALL MATCH THE EXISTING MORTAR IN COMPOSITION AND COLOR; THE MORTAR JOINTS SHALL MATCH IN DIMENSION AND PROFILE

3.: COLOR OF GUTTERS TO BE B:19 BLACK PER HDC'S DESIGN **GUIDELINES**

4.: GENERAL CONTRACTOR TO REPLACE OR REPAIR ALL SOFFITS AND FASCIA WHERE DAMAGED AS REQUIRED. MATCH EXISTING PROFILES. CONFIRM AREAS WITH OWNER

A106 SALVAGE BRICK FROM CRUMBLED BACK PORCH TO USE IN FRONT PORCH AND OR WINDOW CLOSURE (D108)

A107 INSTALL NEW FLAT ROOF TO ACCOMMODATE FOR SLOPING PERGOLA

A108 NEW WOOD PRIVACY FENCE WITH GATE TO MATCH THE EXISTING DECK OF THE CONGREGATION

A109 EXHAUST FAN


1st LEVEL - RESIDENTIAL


1st LEVEL $\overline{EL.} = 100' - 0"$

AVERAGE GRADE $EL. = 98' - 0\frac{1}{2}"$

A110 PROPOSED ADA WOOD RAMP BUILT OF 4x POSTS FINISHED WITH A WOOD CAP. GUARDRAIL PLACED BETWEEN POSTS AT 36" HEIGHT ALONG RAMP AND WOOD RAILING MOUNTED ONTO POSTS AT 34" HEIGHT ALONG RAMP. MAXIMUM SLOPE OF RAMPS TO BE 1:12.

W13 W15 W1 4 \sim $\overline{EL.} = 109' - 1\frac{1}{2}$ " A105

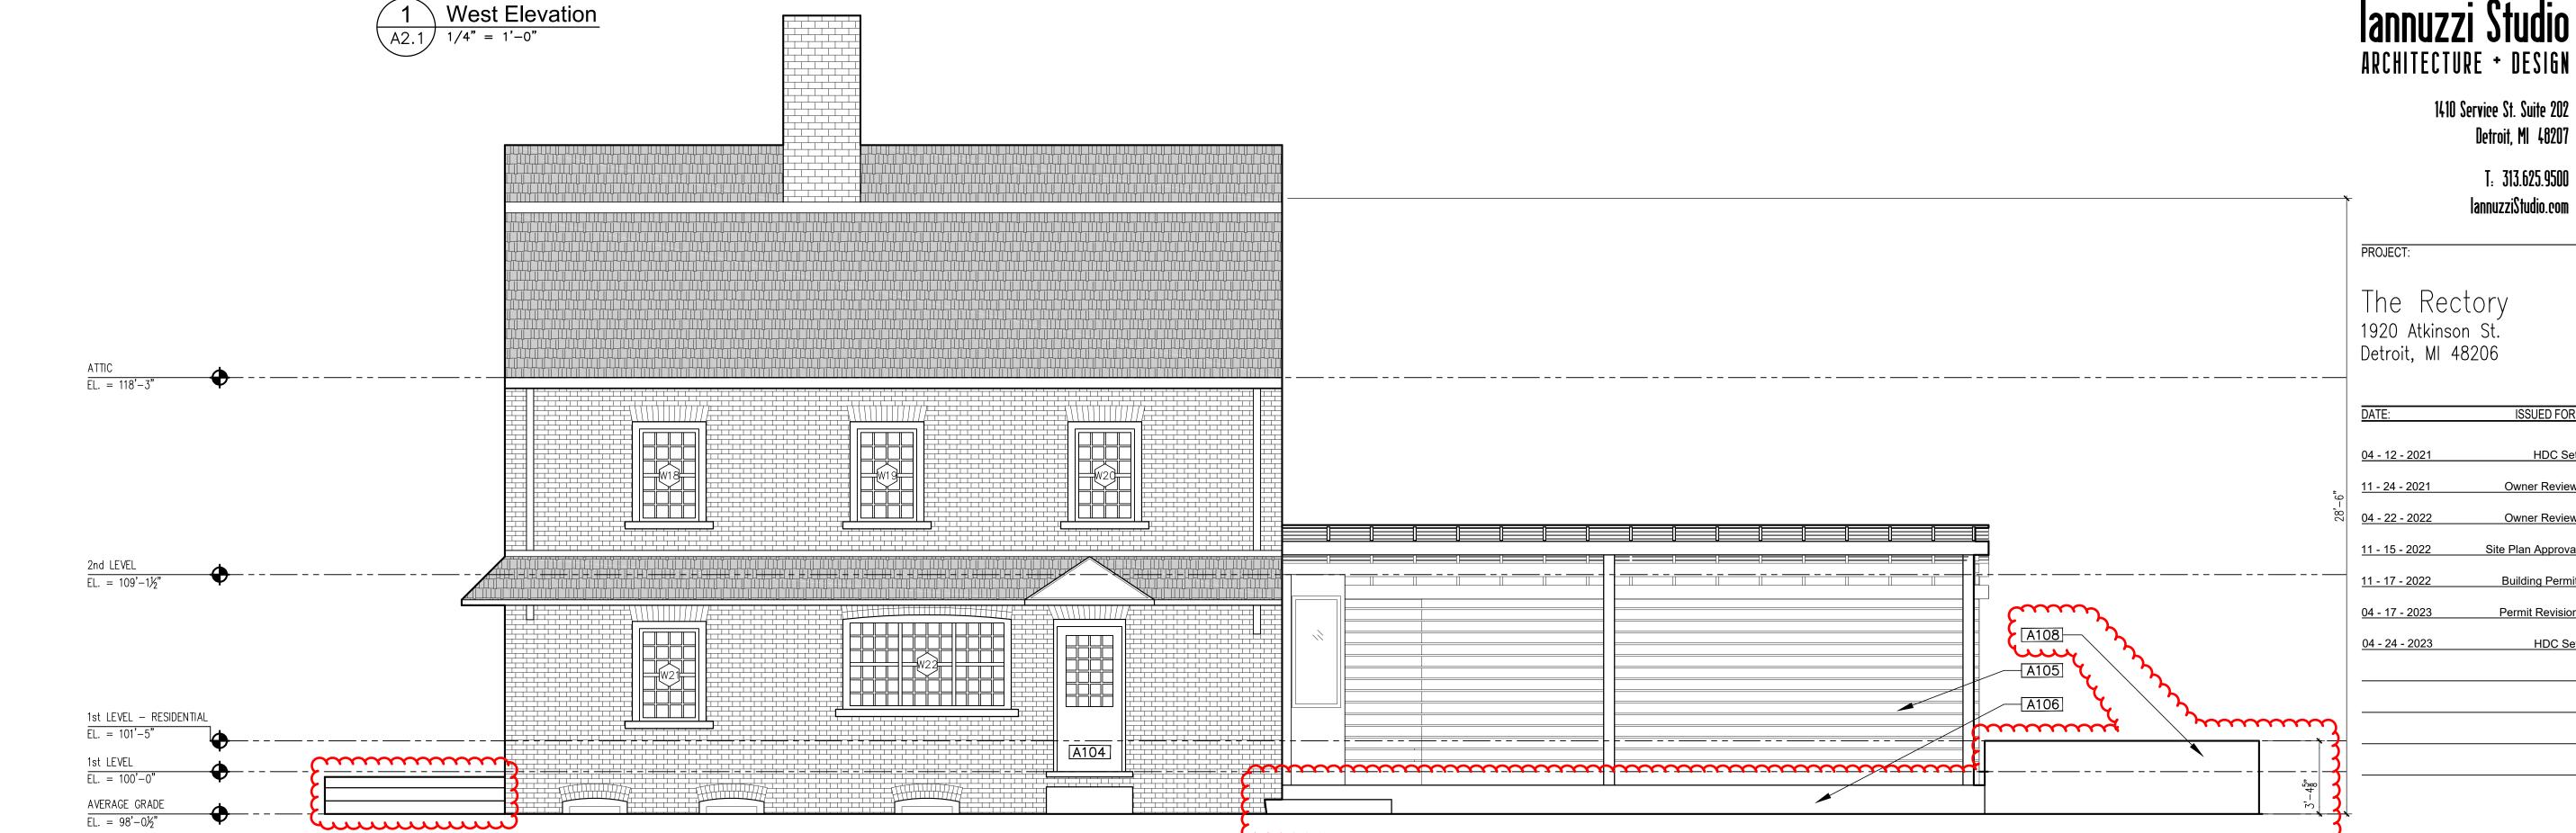



SHEET NUMBER

SHEET TITLE: PROP. EXTERIOR ELEVATIONS © Iannuzzi Studio PLLC 2019

Detroit, MI 48207

T: 313.625.9500

Site Plan Approval

Building Permit

Permit Revision

HDC Set

lannuzziStudio.com

			WINDOW SC	HEDULE		
LABEL	DIMENSIONS	LOCATION	OPERATION	MATERIAL	TRIM/SASH/SILL	COMMENTS
W1	2'-6" V.I.F.	NORTH ELEVATION	DOUBLE-HUNG	WOOD WINDOWS	REPAIRED TO MATCH EXIST. DIMENSIONS AND PROFILE; SEE ELEVATIONS FOR PROPOSED TRIM AND SASH COLORS	DETERIORATION: BROKEN GLASS PANES; ROTTED WOOD ON TRIM, SASH, AND SILL DUE TO YEARS OF NEGLECT LIGHT CONFIGURATION TO MATCH EXISTING WINDOW
W2	2'-0" V.I.F.	NORTH ELEVATION	DOUBLE-HUNG	WOOD WINDOWS	REPAIRED TO MATCH EXIST. DIMENSIONS AND PROFILE; SEE ELEVATIONS FOR PROPOSED TRIM AND SASH COLORS	DETERIORATION: OVER-CAULKED GLASS PANES; ROTTED WOOD ON TRIM, SASH, AND SILL DUE TO YEARS OF NEGLECT LIGHT CONFIGURATION TO MATCH EXISTING WINDOW
W3	2'-8" V.I.F.	NORTH ELEVATION	DOUBLE-HUNG	WOOD WINDOWS	REPAIRED TO MATCH EXIST. DIMENSIONS AND PROFILE; SEE ELEVATIONS FOR PROPOSED TRIM AND SASH COLORS	DETERIORATION: OVER-CAULKED GLASS PANES; ROTTED WOOD ON TRIM, SASH, AND SILL DUE TO YEARS OF NEGLECT LIGHT CONFIGURATION TO MATCH EXISTING WINDOW
W4	1'-6 ³ " V.I.F.	NORTH ELEVATION	DOUBLE-HUNG	WOOD WINDOWS	REPAIRED TO MATCH EXIST. DIMENSIONS AND PROFILE; SEE ELEVATIONS FOR PROPOSED TRIM AND SASH COLORS	DETERIORATION: MISSING GLASS PANES; ROTTED WOOD ON TRIM, SASH, AND SILL DUE TO YEARS OF NEGLECT LIGHT CONFIGURATION TO MATCH EXISTING WINDOW
W5	2'-10" V.I.F.	NORTH ELEVATION	DOUBLE-HUNG	WOOD WINDOWS	REPAIRED TO MATCH EXIST. DIMENSIONS AND PROFILE; SEE ELEVATIONS FOR PROPOSED TRIM AND SASH COLORS	DETERIORATION: MISSING GLASS PANES; ROTTED WOOD ON TRIM, SASH, AND SILL DUE TO YEARS OF NEGLECT LIGHT CONFIGURATION TO MATCH EXISTING WINDOW
W6	2'-10" V.I.F.	NORTH ELEVATION	DOUBLE-HUNG	WOOD WINDOWS	REPAIRED TO MATCH EXIST. DIMENSIONS AND PROFILE; SEE ELEVATIONS FOR PROPOSED TRIM AND SASH COLORS	DETERIORATION: MISSING GLASS PANES; ROTTED WOOD ON TRIM, SASH, AND SILL DUE TO YEARS OF NEGLECT LIGHT CONFIGURATION TO MATCH EXISTING WINDOW
W7	2'-2" V.I.F.	SOUTH ELEVATION	DOUBLE-HUNG	WOOD WINDOWS	REPAIRED TO MATCH EXIST. DIMENSIONS AND PROFILE; SEE ELEVATIONS FOR PROPOSED TRIM AND SASH COLORS	DETERIORATION: OVER-CAULKED GLASS PANES; MISSING GLASS PANE; ROTTED WOOD ON TRIM, SASH, AND SILL DUE TO YEARS OF NEGLECT LIGHT CONFIGURATION TO MATCH EXISTING WINDOW
W8	2'-2" V.I.F.	SOUTH ELEVATION	DOUBLE-HUNG	WOOD WINDOWS	REPAIRED TO MATCH EXIST. DIMENSIONS AND PROFILE; SEE ELEVATIONS FOR PROPOSED TRIM AND SASH COLORS	DETERIORATION: OVER-CAULKED GLASS PANES; MISSING GLASS PANES; ROTTED WOOD ON TRIM, SASH, AND SILL DUE TO YEARS OF NEGLECT LIGHT CONFIGURATION TO MATCH EXISTING WINDOW
W9	2'-9" V.I.F.	SOUTH ELEVATION	DOUBLE-HUNG	WOOD WINDOWS	REPAIRED TO MATCH EXIST. DIMENSIONS AND PROFILE; SEE ELEVATIONS FOR PROPOSED TRIM AND SASH COLORS	DETERIORATION: MISSING GLASS PANES; ROTTED WOOD ON TRIM, SASH, AND SILL DUE TO YEARS OF NEGLECT LIGHT CONFIGURATION TO MATCH EXISTING WINDOW
W10	2'-9" V.I.F.	SOUTH ELEVATION	DOUBLE-HUNG	WOOD WINDOWS	REPAIRED TO MATCH EXIST. DIMENSIONS AND PROFILE; SEE ELEVATIONS FOR PROPOSED TRIM AND SASH COLORS	DETERIORATION: MISSING GLASS PANES; ROTTED WOOD ON TRIM, SASH, AND SILL DUE TO YEARS OF NEGLECT LIGHT CONFIGURATION TO MATCH EXISTING WINDOW
W11	2'-9" V.I.F.	SOUTH ELEVATION	DOUBLE-HUNG	WOOD WINDOWS	REPAIRED TO MATCH EXIST. DIMENSIONS AND PROFILE; SEE ELEVATIONS FOR PROPOSED TRIM AND SASH COLORS	DETERIORATION: MISSING GLASS PANES; ROTTED WOOD ON TRIM, SASH, AND SILL DUE TO YEARS OF NEGLECT LIGHT CONFIGURATION TO MATCH EXISTING WINDOW
W12	2'-9" V.I.F.	WEST ELEVATION	DOUBLE-HUNG	WOOD WINDOWS	REPAIRED TO MATCH EXIST. DIMENSIONS AND PROFILE; SEE ELEVATIONS FOR PROPOSED TRIM AND SASH COLORS	DETERIORATION: OVER-CAULKED GLASS PANES; ROTTED WOOD ON TRIM, SASH, AND SILL DUE TO YEARS OF NEGLECT LIGHT CONFIGURATION TO MATCH EXISTING WINDOW

LABEL	DIMENSIONS	LOCATION	WINDOW SCH OPERATION	MATERIAL	TRIM/SASH/SILL	COMMENTS
W13	2'-9" V.I.F.	WEST ELEVATION	DOUBLE-HUNG	WOOD WINDOWS	REPAIRED TO MATCH	DETERIORATION:
		,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,			EXIST. DIMENSIONS AND PROFILE; SEE ELEVATIONS FOR PROPOSED TRIM AND SASH COLORS	MISSING GLASS PANE OVER-CAULKED GLAS PANES; ROTTED WOO ON TRIM, SASH, AND SILL DUE TO YEARS O NEGLECT
						LIGHT CONFIG. TO MATCH EXIST. WINDO
W14	2'-9" V.I.F.	WEST ELEVATION	DOUBLE-HUNG	WOOD WINDOWS	REPAIRED TO MATCH EXIST. DIMENSIONS AND PROFILE; SEE ELEVATIONS FOR PROPOSED TRIM AND SASH COLORS	DETERIORATION: MISSING GLASS PANE OVER-CAULKED GLAS PANES; ROTTED WOO ON TRIM, SASH, AND SILL DUE TO YEARS O NEGLECT
W15	2'-9" V.I.F.	WEST ELEVATION	DOUBLE-HUNG	WOOD WINDOWS	REPAIRED TO MATCH EXIST. DIMENSIONS AND PROFILE; SEE ELEVATIONS FOR PROPOSED TRIM AND SASH COLORS	LIGHT CONFIG. TO MATCH EXIST. WINDO DETERIORATION: MISSING GLASS PANE ROTTED WOOD ON TRIM, SASH, AND SILL DUE TO YEARS OF NEGLECT
	4					LIGHT CONFIG. TO MATCH EXIST. WINDO
W16	2'-0½" V.I.F.	WEST ELEVATION	FIXED	WOOD WINDOWS	REPAIRED TO MATCH EXIST. DIMENSIONS AND PROFILE; SEE ELEVATIONS FOR PROPOSED TRIM AND SASH COLORS	DETERIORATION: ROTTED WOOD ON TRIM, SASH, AND SILL DUE TO YEARS OF NEGLECT
	7, -9,					LIGHT CONFIG. TO MATCH EXIST. WINDO
W17	2'-9" V.I.F.	WEST ELEVATION	DOUBLE-HUNG	WOOD WINDOWS	REPAIRED TO MATCH	DETERIORATION:
					EXIST. DIMENSIONS AND PROFILE; SEE ELEVATIONS FOR PROPOSED TRIM AND SASH COLORS	MISSING GLASS PANE ROTTED WOOD ON TRIM, SASH, AND SILL DUE TO YEARS OF NEGLECT
	4					LIGHT CONFIG. TO MATCH EXIST. WINDO
W18	2'-9" V.I.F.	EAST ELEVATION	DOUBLE-HUNG	WOOD WINDOWS	REPAIRED TO MATCH EXIST. DIMENSIONS AND PROFILE; SEE ELEVATIONS FOR PROPOSED TRIM AND SASH COLORS	DETERIORATION: MISSING GLASS PANE ROTTED WOOD ON TRIM, SASH, AND SILL DUE TO YEARS OF NEGLECT
	4, -31, -31, -32, -32, -32, -32, -32, -32, -32, -32					LIGHT CONFIG. TO MATCH EXIST. WINDO
W19	2'-9" V.I.F.	EAST ELEVATION	DOUBLE-HUNG	WOOD WINDOWS	REPAIRED TO MATCH EXIST. DIMENSIONS	DETERIORATION: ROTTED WOOD ON
	43½" V.I.F.				AND PROFILE; SEE ELEVATIONS FOR PROPOSED TRIM AND SASH COLORS	TRIM, SASH, AND SILI DUE TO YEARS OF NEGLECT LIGHT CONFIG. TO MATCH EXIST. WINDO
W20	2'-9" V.I.F.	EAST ELEVATION	DOUBLE-HUNG	WOOD WINDOWS	REPAIRED TO MATCH EXIST. DIMENSIONS AND PROFILE; SEE ELEVATIONS FOR PROPOSED TRIM AND SASH COLORS	DETERIORATION: MISSING GLASS PANE ROTTED WOOD ON TRIM, SASH, AND SILE DUE TO YEARS OF NEGLECT
	4, -31,					LIGHT CONFIG. TO MATCH EXIST. WINDO
W21	2'-9" V.I.F.	EAST ELEVATION	DOUBLE-HUNG	WOOD WINDOWS	REPAIRED TO MATCH EXIST. DIMENSIONS AND PROFILE; SEE ELEVATIONS FOR PROPOSED TRIM AND SASH COLORS	DETERIORATION: MISSING GLASS PANE ROTTED WOOD ON TRIM, SASH, AND SILL DUE TO YEARS OF NEGLECT
	-4					LIGHT CONFIG. TO MATCH EXIST. WINDO
W22	7'-1½" V.I.F.	EAST ELEVATION	3 DOUBLE-HUNG WINDOWS; CENTER PANE IS FIXED	WOOD WINDOWS	REPAIRED TO MATCH EXIST. DIMENSIONS AND PROFILE; SEE ELEVATIONS FOR PROPOSED TRIM AND SASH COLORS	DETERIORATION: MISSING GLASS PANE ROTTED WOOD ON TRIM, SASH, AND SILI DUE TO YEARS OF NEGLECT
						LIGHT CONFIG. TO MATCH EXIST. WINDO

	EXTERIOR DOOR SCHEDULE						
LABEL	DIMENSIONS	LOCATION	MATERIAL	TRIM	COMMENTS		
100	3'-2" V.I.F.	NORTH ELEVATION	WOOD	REPLACED TO MATCH EXIST. DIMENSIONS AND PROFILE; SEE ELEVATIONS FOR PROPOSED TRIM COLORS	DETERIORATION: BOARDED UP OPENING, NO DOOR IN PLACE COMMERCIAL GRADE MULTI-GRADE DOOR TO MATCH WINDOW'S DESIGN MAIN ENTRANCE TO RESTAURANT		
102	3'-0" V.I.F.	WEST ELEVATION	WOOD	REPLACED TO MATCH EXIST. DIMENSIONS AND PROFILE; SEE ELEVATIONS FOR PROPOSED TRIM COLORS	DETERIORATION: WOOD DOOR IN EXTREMELY POOR SHAPE COMMERCIAL GRADE MULTI-GRADE DOOR TO MATCH WINDOW'S DESIGN SECONDARY ENTRANCE TO RESTAURANT		
103	2'-8" V.I.F.	NORTH ELEVATION	WOOD	REPLACED TO MATCH EXIST. DIMENSIONS AND PROFILE; SEE ELEVATIONS FOR PROPOSED TRIM COLORS	DETERIORATION: WOOLDOOR IN EXTREMELY POOR SHAPE COMMERCIAL GRADE OR NEAR COMMERCIAL GRADE MULTI-GRADE DOOR TO MATCH WINDOW'S DESIGN ENTRANCE FOR RESIDENTIAL TENANT/S		
104	3'-2½" V.I.F.	SOUTH ELEVATION	WOOD	REPLACED TO MATCH EXIST. DIMENSIONS AND PROFILE; SEE ELEVATIONS FOR PROPOSED TRIM COLORS	NON-OPERABLE; NO HARDWARE TO MATCH WINDOW'S DESIGN		
105	3'-0" V.I.F.	EAST ELEVATION	WOOD	REPLACED TO MATCH EXIST. DIMENSIONS AND PROFILE; SEE ELEVATIONS FOR PROPOSED TRIM COLORS	NON-OPERABLE; NO HARDWARE TO MATCH WINDOW'S DESIGN		

lannuzzi Studio ARCHITECTURE + DESIGN 1410 Service St. Suite 202

Detroit, MI 48207 T. 313.625.9500

lannuzziStudio.com

PROJECT:

The Rectory 1920 Atkinson St. Detroit, MI 48206

 04 - 12 - 2021
 HDC Set

 11 - 24 - 2021
 Owner Review

 04 - 22 - 2022
 Owner Review


 11 - 17 - 2022
 Building Permit

SHEET NUMBER:

A7.0

SHEET TITLE:
Door, Window &
Finish Schedule
© Iannuzzi Studio PLLC 2019

SITE PHOTOS

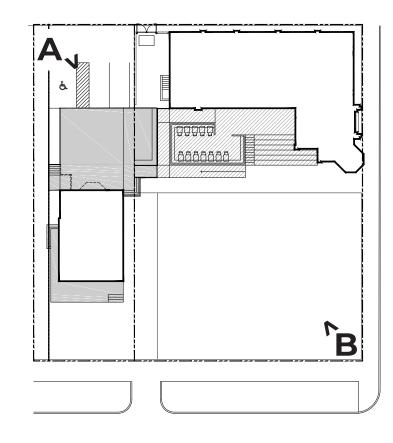







B - FRONT CORNER OF THE SITE



EXISTING ELEVATIONS







NORTH ELEVATION

REMOVING WINDOW TO
MOVE DOOR 103 UP FOR
NEW PATIO - SEE
ELEVATIONS AND PLANS



SOUTH ELEVATION



SOUTH ELEVATION



EXISTING ELEVATIONS










WEST ELEVATION EAST ELEVATION



EXISTING DETAILS





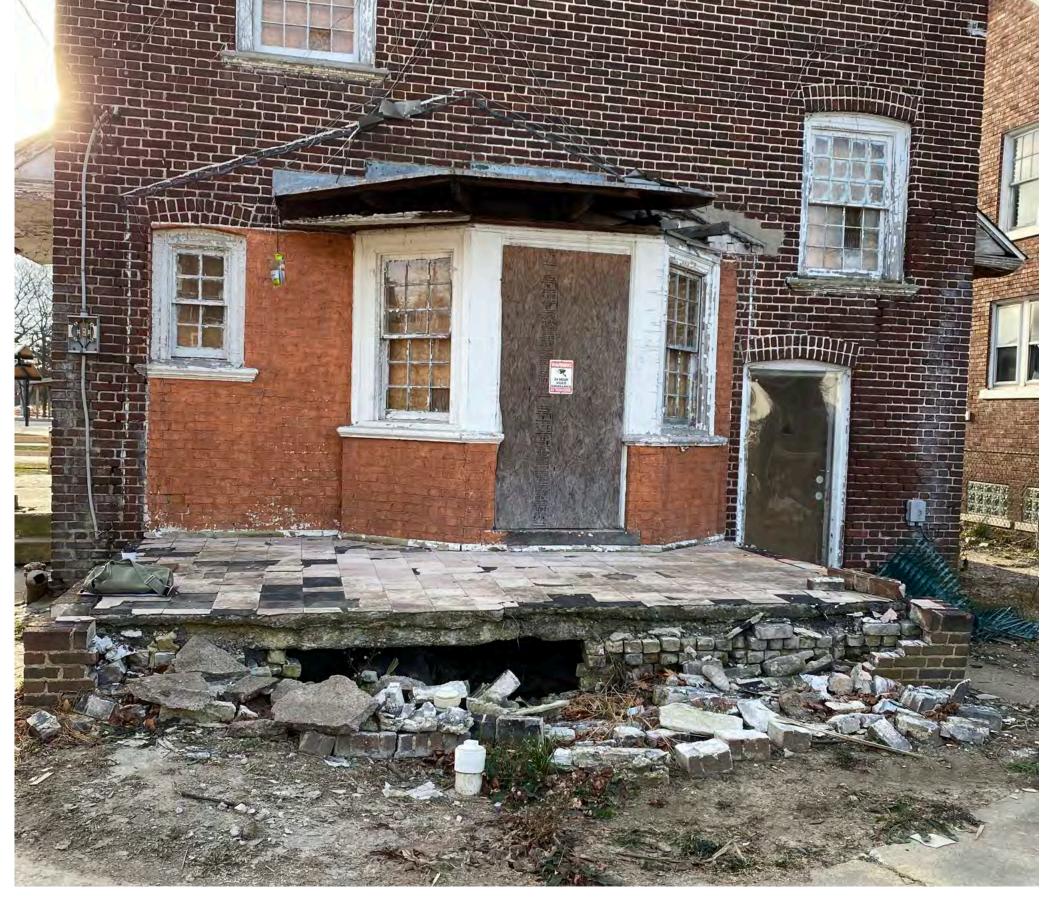

PORCHES

SALVAGE BRICK FROM CRUMBLED BACK PORCH TO USE IN FRONT PORCH AND OR WINDOW CLOSURE (D108)








WINDOWS

ALL WINDOWS, BRICK MODELS, AND WINDOW SILLS WILL BE RESTORED OR REBUILT TO MATCH CURRENT. COLOR IS TO BE C:4 YELLOWISH WHITE WITH B:19 BLACK FOR THE TRIM PER HDC'S DESIGN GUIDELINES

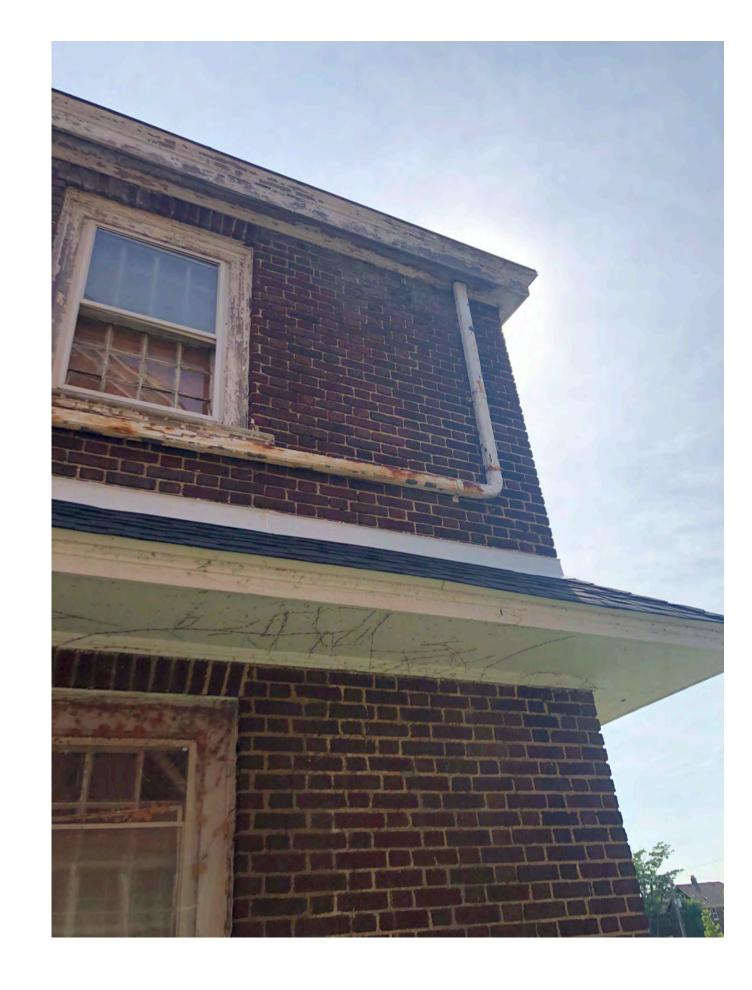


GUTTERS

COLOR OF GUTTERS TO BE B:19 BLACK PER HDC'S DESIGN GUIDELINES



EXISTING DETAILS

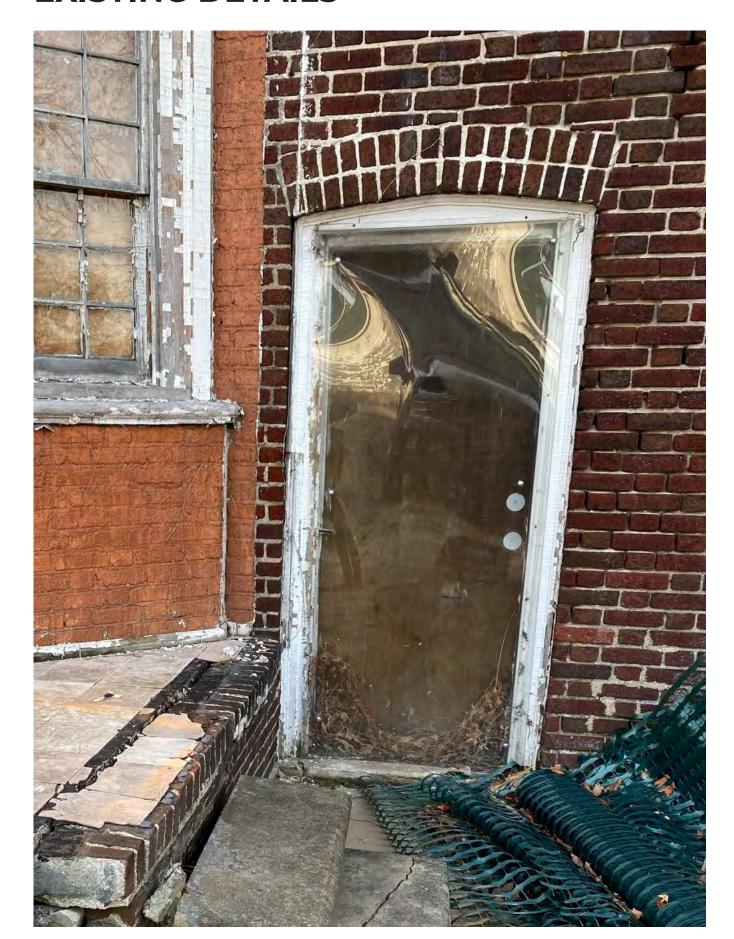


DOOR A - NEW DOOR SILL HEIGHT AND DOOR (103) FOR RESIDENTIAL TENANTS - SEE DOOR SCHEDULE FOR DETAILS

EXISTING MATERIAL: WOOD



DOOR B - NEW DOOR (102) FOR SECONDARY ENTRANCE TO RESTAURANT - SEE DOOR SCHEDULE FOR DETAILS

EXISTING MATERIAL: WOOD; CURRENT DOOR IS MISSING AND IS HELD BY AN ACRYLIC PIECE

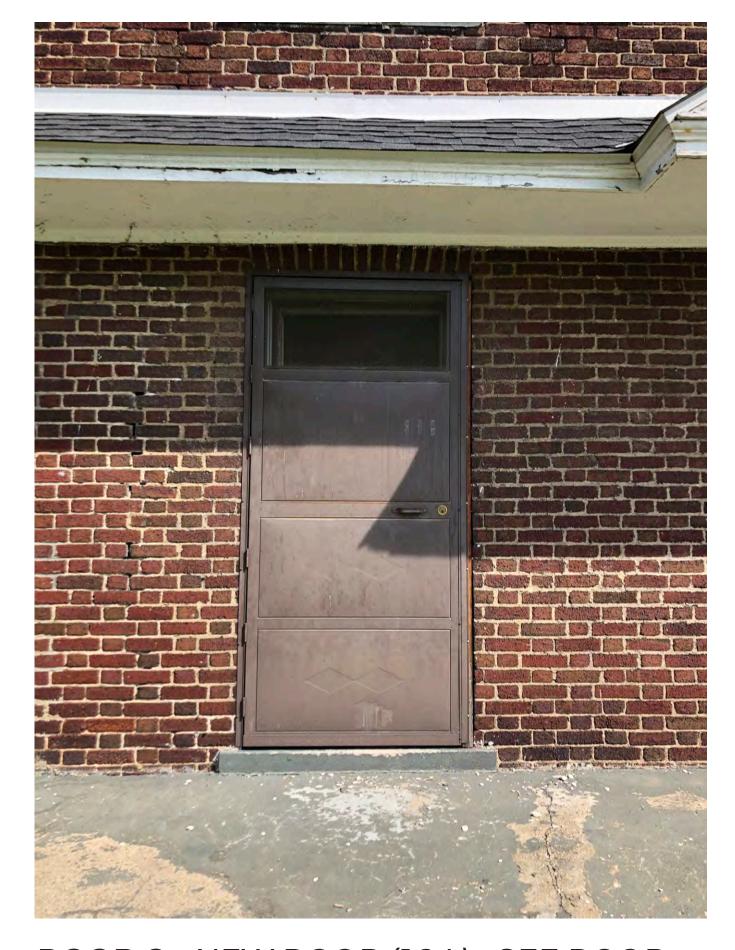

DOOR C - NEW DOOR (104) - SEE DOOR SCHEDULE FOR DETAILS

EXISTING MATERIAL: METAL



DOOR D - NEW DOOR (105) - SEE DOOR SCHEDULE FOR DETAILS

EXISTING MATERIAL: WOOD

DOORS


ALL EXTERIOR NON-HISTORIC DOORS TO BE REPLACED.

NORTH ELEVATION DOOR TO BE RELOCATED. SEE PROPOSED ELEVATIONS AND DOOR SCHEDULE.

THE DOOR WOOD TRIMS ARE ROTTED AND NEED TO BE REPLACED AS WELL. BECAUSE THE FIRST FLOOR WILL BE A COMMERCIAL SPACE, ALL EXISTING DOORS ARE NOT TO CODE AND MUST SWING OUT. NEW DOORS WILL MIMIC ADJACENT WINDOW DESIGN.




CUT SHEETS

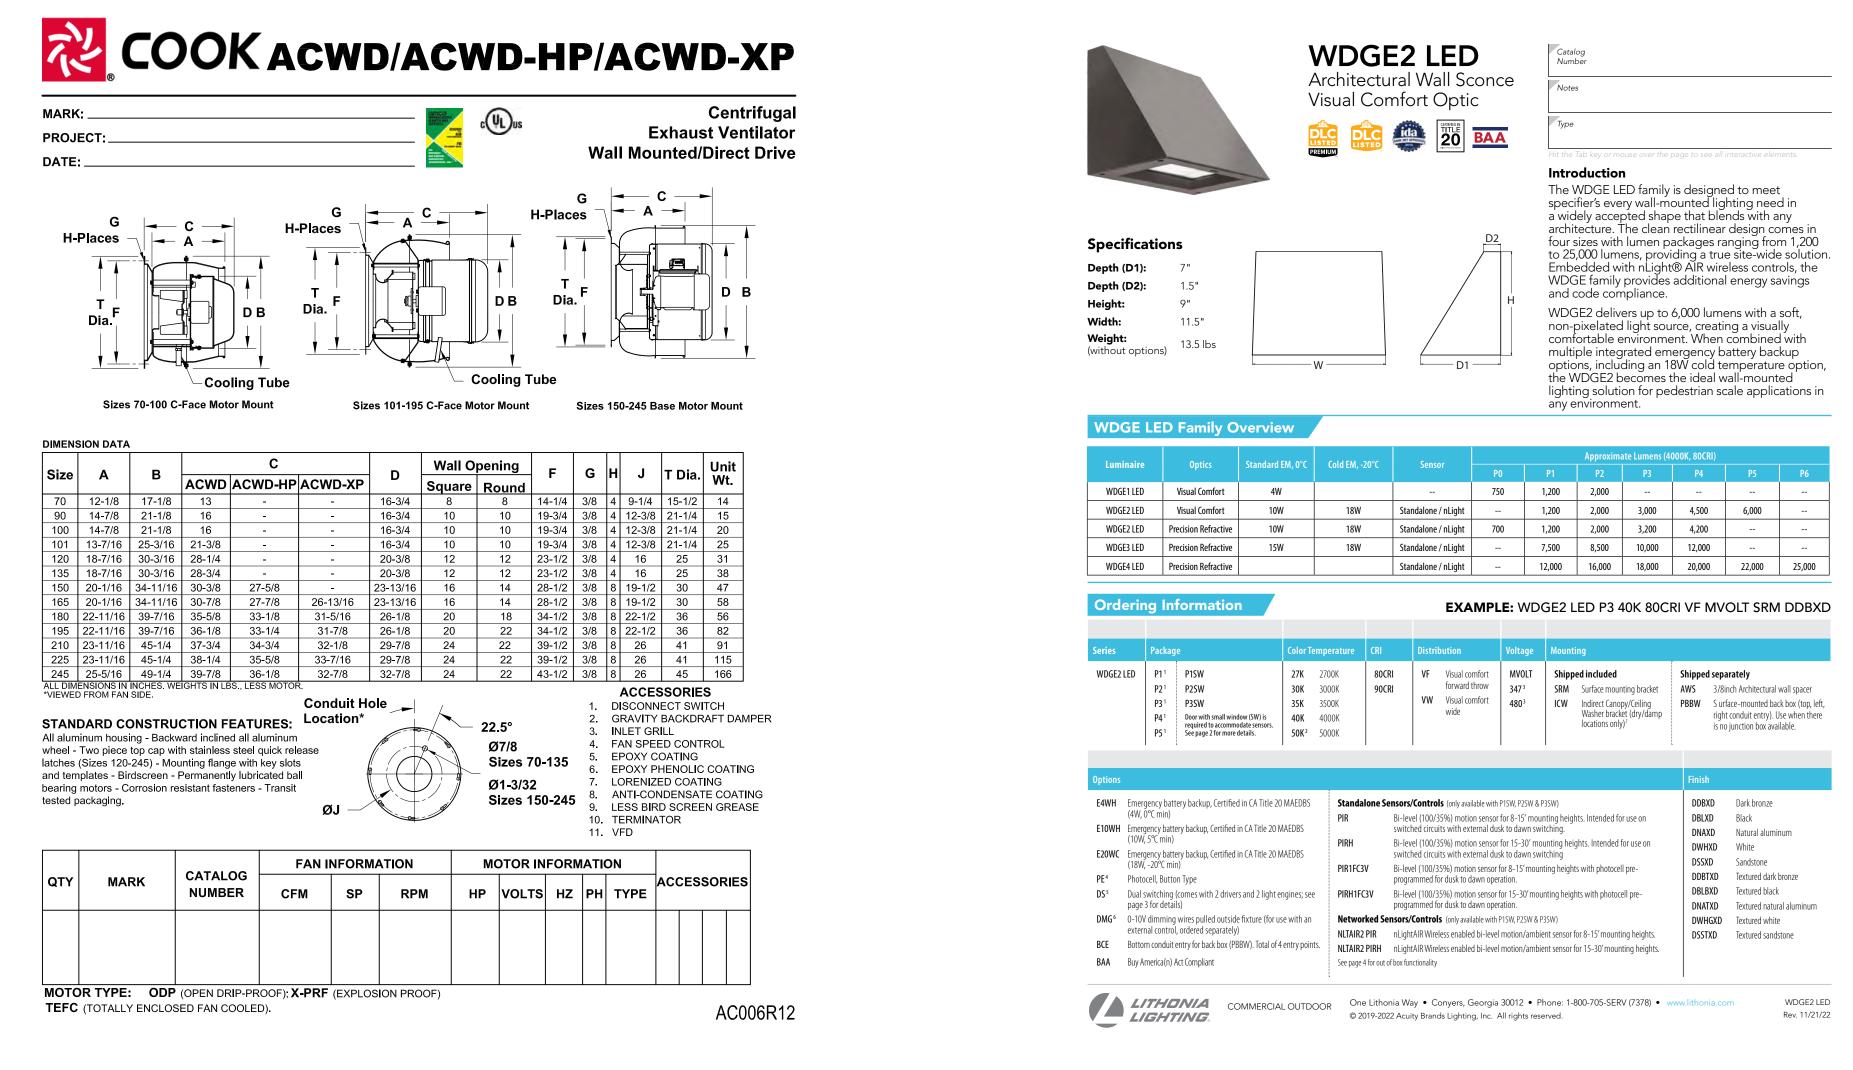



EXHAUST FAN NEW OUTDOOR LED SCONCES, TYPICAL




CUT SHEETS

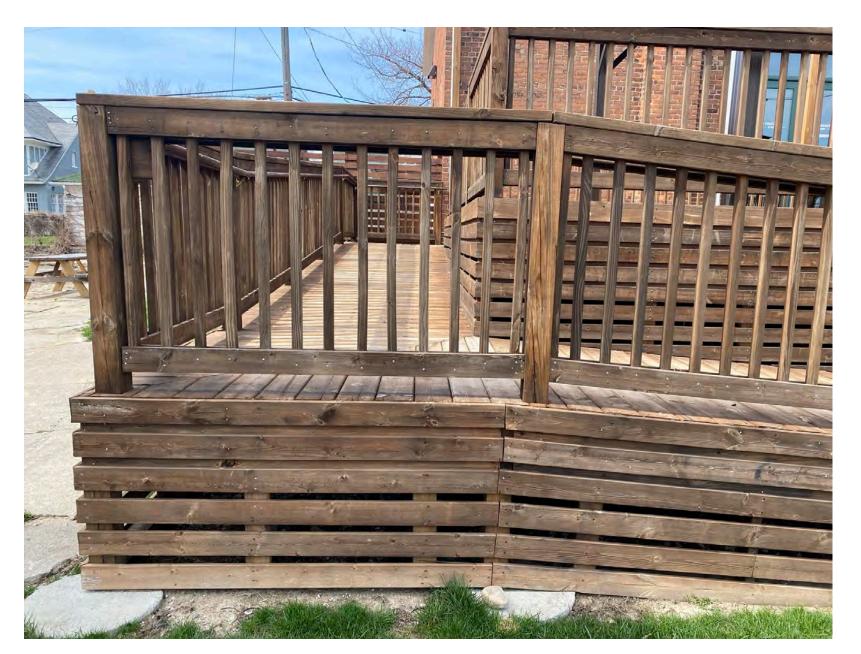

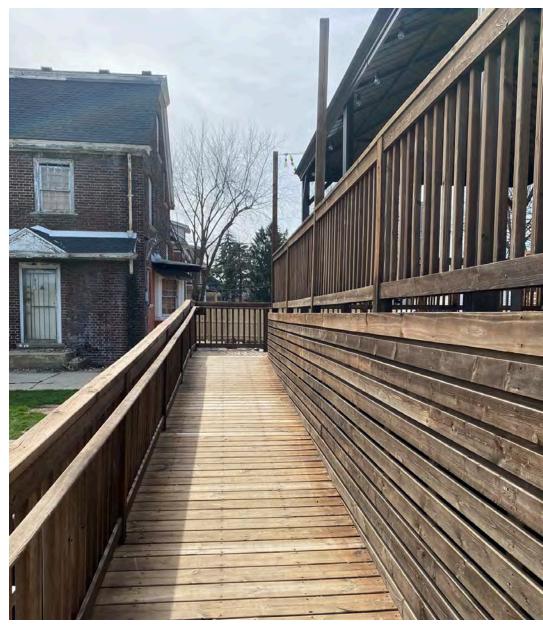

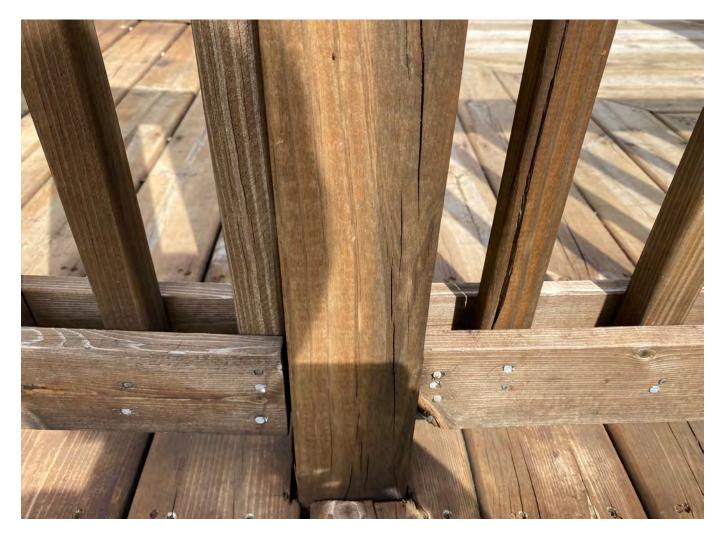

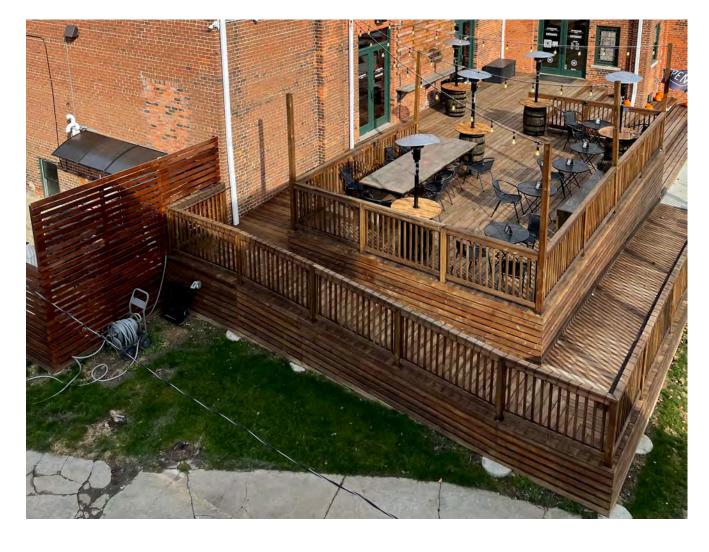

PROPOSED ADA RAMP TO MATCH THE EXISTING MATERIALS AND CONSTRUCTION OF THE CONGREGATION RAMP



PROPOSED PRIVACY FENCES FOR MEP EQUIPMENT TO MATCH EXISTING MATERIALS OF THE CONGREGATION DECK





PROPOSED EXTENDED FENCE WITH GATE TO CONNECT TO EXISTING FENCE WITH GATE AT THE CONGREGATION. MATERIALS AND CONSTRUCTION TO BE THE SAME AS THE CONGREGATION

